CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Corner established in 1882 by General Land Office by contract.

Original survey record states. Set a basalt stone 13x8x7 inches 9 inches in ground for cor to sections 8,9,17, and 16 marked with 4 notches on S and 4 notches on E edges from which; A pine 20" in diam, bears N37°W 18 lks dist marked T3S R35E SBT. A fir 18 inches in daim, bears \$74.0 125 lks dist marked T3S R35E

J-9					
	DIAGRAM				
	T3S	R35EWM			
		So S16			
SI	7BT.				

A pine 20" in diam bears N37°W 18 lks dist with scribe visible.

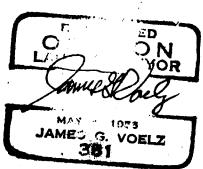

at the position of the corner I set a 2" galvanized pipe 30" long with bronze cap on top and 8" plate welded to bottom at a depth of 6 inches and raised

I stamped the disk.

From the pipe monument the original bearing tree is; A pine 20^H in diam bears N37°W 18 lks dist. I set the following new bearing trees;
A pine 14" in diam bears N52°E 64 feet dist marked T3S,
R35E S9BT. A pine 12" in diam bears S344 19 feet dist
marked T3S R35E S16BT; A fir 9" in diam bears S32°W.83 feet
dist. marked T3S R35E S17BT; (Distance measured to center of respective trees

COR **T3S** R35E 58 39

and marked with scribe.) I set a steel fence post with USFS sign 54-4 attached. A Mational Forest Boundary sign was attached to post indicating National Forest Land to North. USFS bearing tree signs were placed on bearing trees shoulder high facing the corner.

	T		
Office of County Surveyor County of Union State of County of Union Stat	N COUNTY		
Co Surveyor			
(COUNTY OFFICIAL)	/ed		
Date Filed			
Ву			
File No. 4	-08-81D		

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

See filing by James Voelz on August 27, 1969.

DIAGRAM T 3 S	R 35 E		
S 8	S 9		
S 17	S 16		

Description of corner evidence found:

This corner was incorrectly set in August, 1969, due to copy of original notes reading 18 links instead of 181 links distance from Section 8 B.T. James Voelz requested that the undersigned move the existing monument to its correct position.

This was accomplished May 16, 1978. The original stone 17 ins. x 8 ins. x 18 ins., with 4 notches on one side and two faint markings on an adjacent side was found at the proper location.

An original bearing tree,

 $^{\rm A}$ pine, 20 ins. in diam. bears ". 37° W. 18 lks. dist. marked T 3 S $_{\rm R}$ 35 E S $_{\rm S}$ BT.

The stone was buried alongside the relocated 3 inch brass cap on 2 inch iron monument, which is 32 ins. long, 20 ins. in the ground.

New bearing trees were marked:

A pine, 12 ins. in diam. bears N. 13° E. 104.0 ft. dist. marked T 3 S R 35 E S 9 BT.

A pine, 10 ins. in diam. bears S. 62° 30' W., 72.5 ft. dist. marked T 3 S R 35 E S 17 BT.

The corner previously marked by Voelz:

A pine, 14 ins. in diam. bears S. 30° 30' E., 85.0 ft. dist. marked T 3 S R 35 E S 16 BT.

Set steel fence post 4 ft. north with F. S. signs 54-4 and 54-2 attached and erected a rock mound 2 ft. south of monument.

Witnesses:
Bill Hanley
Brad Gordon
Dave Dahlstrom

Office of			REGISTERED PROFESSIONAL LAND SURVEYOR	
for record on the day of by		T	AMES D. HANLE SEPTEMBER 23 1977 JAMES D. HANLE!	
	Date Received		1206	

Form R6-7100-57 (9/71)

GPO 796-333