

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment: Corner established in 1882 by Rufus S. Moore under General Land office contract no. 451. Surveyor General Record States;

Set post for  $\frac{1}{4}$  corner

From which;

A pine 20" in diameter bears N 32 E, 45 links.

A pine 20" in diameter bears N 30 W, 64 links.

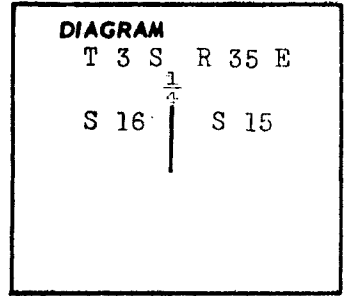

No record of remonumentation found in the county record.

**Description of corner evidence found:**

NW BT. , still living and still standing, blaze scar visible, did not open

NE. BT. dead and standing, scribes visible.

Did not find post.

**Description of monument and accessories I established to perpetuate the**

original location of this corner I set a  $2\frac{1}{2}$ "x30" galvanized iron pipe 24" in the ground at the called distance and bearing from the BTs. From which;


New BT.

A fir 11 inches in diameter bears N 73 E a distance of 46.2 feet, marked  $\frac{1}{4}$ S 15 Bt.

I placed a nail and a brass washer marked O.P.L.S. 991 at the BT. blaze.

I used a steel tape and a magnetic compass with 20 degrees East declination set into the compass.

I set a steel fence post with sign 5.0 feet North of the corner.

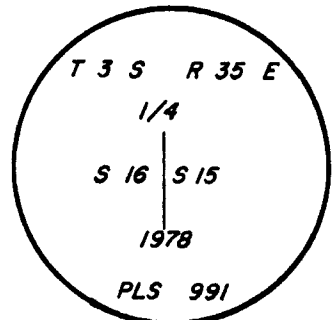

**REGISTERED PROFESSIONAL LAND SURVEYOR**

*Gregory T. Blackman*

**OREGON JUL 3, 1973 GREGORY T. BLACKMAN 991**

Office of *Union* County of *Union*  
State of *Oregon*, I hereby certify that the within instrument was filed in this office  
for record on the *18* day of *Sept.*, 1978  
*J. Vance* (COUNTY OFFICIAL) by *J. Laffer* (DEPUTY)

**UNION COUNTY SURVEYOR**

Received \_\_\_\_\_

Date Filed \_\_\_\_\_

By \_\_\_\_\_

File No. *416-84 R*

GPO 796-333