


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: Corner established in 1882 by Rufus S. Moore under General Land Office contract No. 451. SURVEYOR GENERAL RECORD STATE;

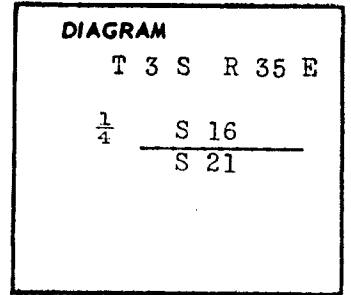

Set post for $\frac{1}{4}$ corner.

From which:

A pine 34" in diameter bears S 32 E, 58 lks.

A pine 24" in diameter bears N 42 W, 54 lks.

I did not find any record of remonumentation in the county record.

Description of corner evidence found:

Found

SE. BT. bottom of blaze and chaining notch visible.

Found stump hole at record bearing and distance for NW. BT.

Did not find post.

Description of monument and accessories I established to perpetuate the original location of this corner I set a 2 $\frac{1}{2}$ "x30" galvanized iron pipe with brass cap 24" in the ground at the record distances and bearings from the BTs., from which;

New BTs.


A fir 10" in diameter bears S 35 W a distance of 21.0 feet marked $\frac{1}{4}$ S 21 BT.

A fir 10" in diameter bears N 67 W a distance of 22.5 feet marked $\frac{1}{4}$ S 16 BT.

I placed a nail and a brass washer marked O.P.L.S. 991 at the BT. blaze.

I used a steel tape and a magnetic compass with 20 degrees East declination set into the compass.

I set a steel post with a sign 5.0 feet East of the corner.

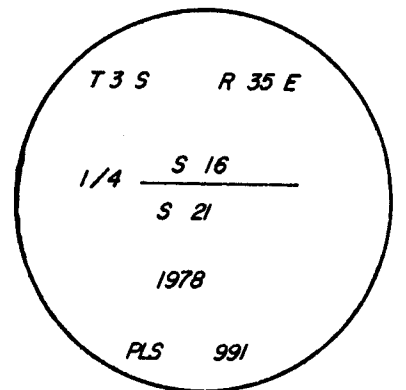

REGISTERED PROFESSIONAL LAND SURVEYOR

Gregory T. Blackman

OREGON JUL 3, 1978 GREGORY T. BLACKMAN 991

Office of Surveyor County of Union
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 18 day of Sept. 1978
J. V. [Signature] by [Signature]
(COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR

Date Received _____

Date Filed _____

By _____

File No. 421-84 R GPO 796-333