## **UNION COUNTY** CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by John H. Hurlburt under GLO Contract Number 201, dated August 5, 1873, Surveyor General record states: Post 4 inches square in ground in. for & Sec. Cor. from

T39 R36E E-15 3

DIAGRAM

A 20 inch diameter Pine bears N28-%°E, 106 Lks. A 40 inch diameter Pine bears S31°W, 89 Lks.

No record of subsequent monumentation found in Union County survey records.

Description of corner evidence found:

Found no evidence of the original corner monument.

Area had been logged and burned.

See Map of Survey Number 028-1992.

Description of monument and accessories I established to perpetuate the


original location of this corner: At the proportionate position, determined by survey I x30" aluminum pipe with aluminum cap marked as shown, 27 inches in the ground, I set a which; from

New Bearing Trees; A 12 inch diameter Ponderosa pine bears N74°E, 32.92 feet marked X BT A 10 inch diameter Ponderosa pine bears S41°E, 21.93 feet marked X BT A 13 inch diameter Ponderosa pine bears S3°W, 36.47 feet marked ½ S10 BT A 15 inch diameter Ponderosa Pine bears N63°W, 7.64 feet marked ½ S3 BT

Raised a small mound of stone. Set a steel fence post approximately 5 feet East, with a 54-9 sign attached.

I hereby certify that the above corner point was perpetuated as hereon described on July 13, 1992.

Witness: Jim Bennett Pete Crabtree

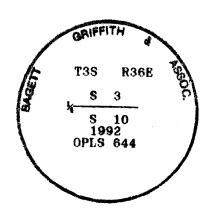

I used a steel tape and magnetic compass in the establishment of new accessories. I used 20° East magnetic declination and the distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

REGISTERED **PROFESSIONAL** AND SURVEXOR

OREGON JULY 10, 1964 DUANE I. GRIFFITH 644

VILLED ROSE CONT File No. 105-1992R

E-15 5515

1-10