
UNION COUNTY CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: This corner was never established.

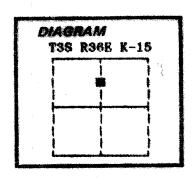

No record of subsequent monumentation found in Union County survey records.

Description of corner evidence found:

See Map of Survey Number 028-1992.

Description of monument and accessories I established to perpetuate the original location of this corner:

At position, determined by survey I set a 2%"x30" aluminum pipe with aluminum cap marked as shown, 29 inches in the ground, from which;

New Bearing Trees;


A 12" Ponderosa pine bears N34°E, 154.34 feet mk'd T3S R36E CN 1/16 S15 BT A 17" Lodgepole pine bears S44°E, 84.39 feet mk'd T3S R36E CN 1/16 S15 BT

Raised small mound of stone, 3 foot base to top of cap.

Set a steel fence post approximately 5 feet East, with a 54-9 & 54-4 signs attached.

I hereby certify that the above corner point was perpetuated as hereon described on September 1, 1992.

Witness: Jim Bennett Jeff Peterson

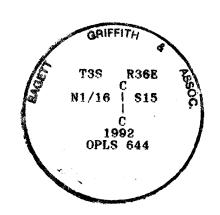

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON JULY 10, 1964 DUANE I. GRIFFITH I used a steel tape and magnetic compass in the establishment of new accessories. I used 20° East magnetic declination and the distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

Date Received 11/23/92

Date Ricd 11/20/82

By Ly Black

File No. 121-19921C

K-15 6015

2-10