


UNION COUNTY
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by John H. Hurlburt under GLO Contract Number 201, dated August 5, 1873. Surveyor General record states:
Set Stone 18x15x6 inches marked $\frac{1}{4}$ in a mound of stone for $\frac{1}{4}$ Sec. Cor.

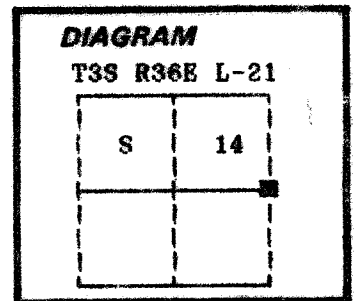

No record of subsequent monumentation found in Union County survey records.

Description of corner evidence found:

Found stone 18x16x7 marked $\frac{1}{4}$ on East side of rock jack.

See map of Survey Number 028-1992.

Description of monument and accessories I established to perpetuate the original location of this corner:

In place of stone, I set a 2 $\frac{1}{2}$ "x30" aluminum pipe with aluminum cap marked as shown, 18 inches in the ground, from which;


New Bearing Trees or Object:

- A 5/8x30 inch rebar bears N54°E, 68.62 feet marked T3S R36E $\frac{1}{4}$ S13 RM 1992 68.62 OPLS 644.
- A 5/8x30 inch rebar bears S62°E, 58.15 feet marked T3S R36E $\frac{1}{4}$ S13 RM 1992 58.15 OPLS 644.
- A 22 inch diameter Ponderosa Pine double bole bears S44°W, 195.70 feet marked $\frac{1}{4}$ S14 BT.
- A 5/8x30 inch rebar bears N26°W, 9.40 feet marked T3S R36E $\frac{1}{4}$ S14 RM 1992 9.4 OPLS 644.

Raised a 4 foot mound to top of cap.
Set a steel fence post approximately 5 feet North with Attention sign attached.

I hereby certify that the above corner point was perpetuated as hereon described on July 6, 1992.

Witness: Jim Bennett

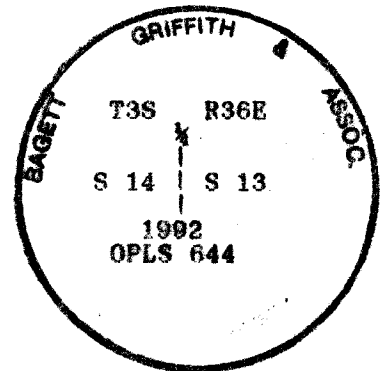

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 10, 1964
DUANE I. GRIFFITH
644

I used a steel tape and magnetic compass in the establishment of new accessories. I used 20° East magnetic declination and the distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

**UNION COUNTY
SURVEYOR**

Date Received 11/23/92

Date Filed 11/29/92

By [Signature]

File No. 129-1992R