


**C. UNIFIED RECORD OF LAND CORNER MONUMENT. ION**

**HISTORY OF ORIGINAL CORNER ESTABLISHMENT:**

Corner not previously established

**DESCRIPTION OF CORNER EVIDENCE FOUND:**

None

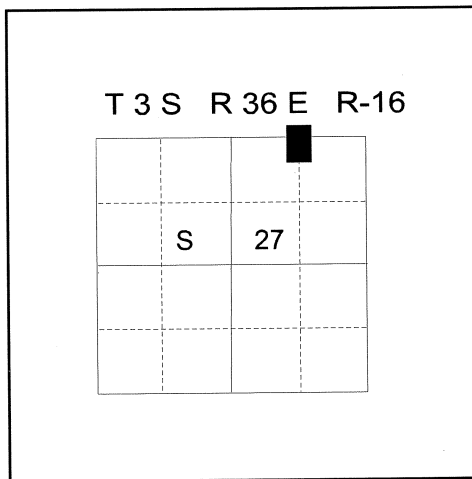

**See Union County Survey Number 003-2009**

**DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:**

At the position determined by survey, I set a 5/8" iron pin with aluminum cap marked as shown, 29 inches in the ground from which;

**NEW BEARING TREES:**

A 16" Douglas Fir bears South 88° West, a distance of 18.95 feet, marked E 1/16 S27 BT.

An 8" Douglas Fir bears North 9° West, a distance of 40.43 feet, marked E 1/16 S22 BT.

I set a steel fencepost 1 ft. south of the corner. A North/South running fenceline falls approximately 8 feet East of corner.

I hereby certify that the corner was set January 22, 2009


Witnesses: Greg T. Blackman Jr. & Jeff Hsu

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Rick G. Robinson*

OREGON  
July 17, 1986  
RICK G. ROBINSON  
2219

Renewal Date: December 31, 2010

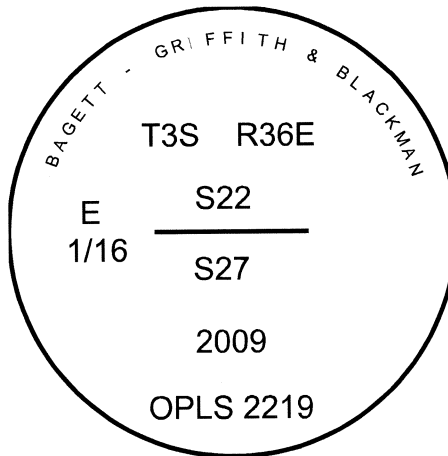

**UNION COUNTY SURVEYOR**

Date Received 1/23/09

Date Filed 1/23/09

Filed By *Greg T. Blackman Jr.*

File Number 002-2009 R

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 18° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing tree. I attached a brass washer marked OPLS 2219 to the BT blaze.