
## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

## History of original corner establishment:

Corner not previously established.

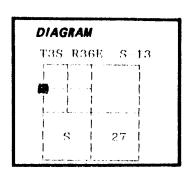

No record of subsequent monumentation found in Union County survey records

Description of corner evidence found:

Corner not previously established. See Union County Survey Number 25-89

## Description of monument and accessories I established to perpetuate the

original location of this corner:  $\Delta t$  position determined by survey, 1 set a 2½" x 30" aluminum pipe with aluminum cap marked as shown, 14 inches in the ground, from which;

New Bearing Trees; A 21 inch diameter Pouderesa Fine bears N25°W, 71.63 feet marked N1/16 S28 BI NO OTHER TREES AVAILABLE

Raised a mound of stone around monument; 4 ft base to top of eap.

Painted a 6 inch red band around all BTs and attached Bearing Tree and Land Survey Monument signs.

Set a steel fencepost approximately 5 feet North with Land Survey Monument sign attached.

I bereby certify that the above corner point was perpetuated as beseon described on October 1, 1989.

Witness: Jeff Potersen

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON
JULY 13, 1973
GREGORY, T. BLACKMAN
991



I used a steel tape and magnetic compass in the establishment of new accessories. I used 17° magnetic declination. The distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 991 to the BT blaze.

Office of	County of	• • • • • • • • • • • • • • • • • • • •
State of / /	ereby certify that the within instmu	ent was filed in this office
for record on the day of	UNION COUNTY SURVEYOR	
(COUNTY OFFICIAL)	(	PEPUTY)

Form R6-7100-57 (9/71)

1-25

Date Received 11-14-89

Date Riled 11-14-89

R. ROBINSON, DENTY

•GPO-591-971, 1988

S = 1.3