

RESTORED CORNERS

Section 31, Township 2 South, Range 37 East W. M.

Hilgard Junction State Park

Union County

August 28, 1969

Var 20°

SECTION CORNER 5, 6, 31 and 32

ORIGINAL:

Post and mound of stone (found rotted post and mound of stone and Forest Service tag dated 1947) (T3SR37ES6BT)

RESTORED:

19" Pine S15°W 34.8 ft. scribed, "T3SR37ES6BTRS691"
18" Pine S63°W 82.8 ft. scribed, "T3SR37ES6BT"
18" Pine N1°W 87.4 ft. scribed, "T2SR37ES31BT"
No trees available in other sections.
Yellow corner tag on 19" BT.

Witnessed by: A. Slack
R. Hemmer
T. Stose

| | |
|------------------------------|---------|
| UNION COUNTY SURVEYOR | |
| Date Received | _____ |
| Date Filed | _____ |
| By | _____ |
| File No. | 316-84R |

SECTION CORNER 29, 30, 31 and 32

ORIGINAL:

Stone and mound (found stone out of place)
15" Pine S31°W 105 LKS. (now 24" stump, scribe visible)

RESTORED:

Reset stone from BT.
Erected mound of stone around cornerstone.
Pine N75°W 111.2 ft. scribed, "T2SR37ES30BTRS691"
Yellow corner tag on new Pine BT.
Another mound of stones bears South 6 ft.

Witnessed by: A. Slack
R. Hemmer
T. Stose

| | |
|------------------------------|---------|
| UNION COUNTY SURVEYOR | |
| Date Received | _____ |
| Date Filed | _____ |
| By | _____ |
| File No. | 317-84R |

1/4 CORNER 30 and 31

ORIGINAL:

Stone (found out of place)
12" Pine N41°E 21 LKS. (now 12" stump, "BT" visible)
12" Pine S30°E 25 LKS. (now missing)

RESTORED:

Set original stone in place.
Erected mound of stone around cornerstone.
Set 4" x 4" x 48" white post 1 ft. South of corner.
10" Pine S79°W 6.3 ft. scribed, "1/4S31BTRS691"
10" Pine N36°E 23.2 ft. scribed, "1/4S30BT"

Witnessed by: J. Hollingsworth
E. Haury
R. Hemmer
T. Stose

| | |
|------------------------------|---------|
| UNION COUNTY SURVEYOR | |
| Date Received | _____ |
| Date Filed | _____ |
| By | _____ |
| File No. | 318-84R |

REGISTERED
OREGON
LAND SURVEYOR

John E. Hollingsworth
JULY 9, 1969
John E. Hollingsworth
691

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Corner originally established by William H. Odell under GLO contract number 120, dated May 27, 1867. Surveyor General record states:
Set post cor. for Secs. 5, 6, 31, 32. Deposited marked stone and raised stone mound as per instructions

Corner perpetuated in August, 1969 by John E. Holingsworth, OPLS 691. His record states:

ORIGINAL:
Post and mound of stone (found rotted post and mound of stone and Forest Service tag dated 1947)

RESTORED:
19" Pine S15°W 34.8 ft. scribed "T3SR37ES6BTRS691"
18" Pine S63°W 82.8 ft. scribed "T3SR37ES6BT"
18" Pine N1°W 87.4 ft. scribed "T2SR37ES31BT"
No trees available in other sections.
Yellow corner tag on 19" BT.

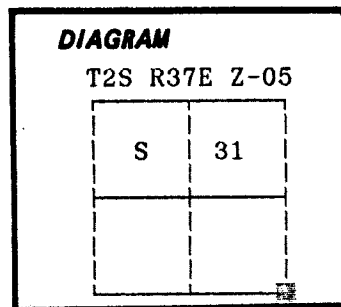

No record of subsequent monumentation found in Union County survey records.

Description of corner evidence found:

Found large mound of stone with wooden post in center.

Found a 24 inch diameter Ponderosa Pine S15°W, 34.8 feet live and vigorous with healed blaze.

Found a 25 inch diameter Ponderosa Pine S63°W, 82.8 feet live and vigorous with scribes visible.

Found a 23 inch diameter Ponderosa Pine N1°W, 87.4 feet live and vigorous with healed blaze.

See map of survey dated January, 1989.

| UNION COUNTY SURVEYOR | |
|-----------------------|----------------------------|
| Date Received | <u>2-13-89</u> |
| Date Filed | <u>2-13-89</u> |
| By | <u>G. LANGLITZ, DEPUTY</u> |
| File No. | <u>36-89 R</u> |

Description of monument and accessories I established to perpetuate the original location of this corner:

In center of mound of stone, I set a 2½" x 30" aluminum pipe with aluminum cap marked as shown, 18 inches in the ground, from which:

New BT:


A 14 inch diameter Ponderosa Pine bears N17°E, 143.27 feet marked T2S R37E S32 BT

Painted a 6 inch red band around all BTs and attached bearing tree and land survey monument signs.

Set a steel fencepost approximately 5 feet East with land survey monument sign attached.

Raised mound of stone around monument, 5 ft. base to top of cap.

I hereby certify that the above corner point was perpetuated as hereon described on November 5, 1988.

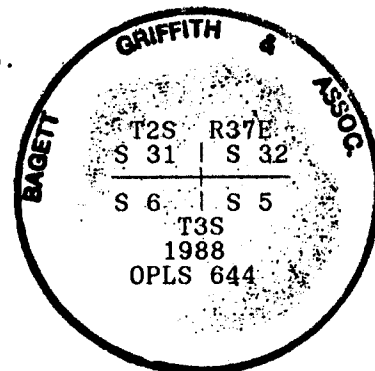

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON
JULY 10, 1964
DUANE I. GRIFFITH
644

I used a steel tape and magnetic compass in the establishment of new accessories. I used 17° East magnetic declination and the distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

Office of..... County of.....
State of.....; I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)