
## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

## HISTORY OF ORIGINAL CORNER ESTABLISHMENT:


Corner originally established by William H. O'Dell under GLO contract Number 120, dated May 27, 1867. Surveyor General record states:

Set post corner for sections 5-6-7-8, deposited marked stone and raised mound of stone.

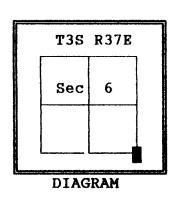

No record of subsequent monumentation found in Union County survey records DESCRIPTION OF CORNER EVIDENCE FOUND:

Found stone 12" X 10" X 3" marked with a 3" cross, in an old rock jack.

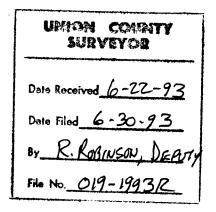

See Union County Survey Number 1993-020.

## DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

In place of stone, I set a  $2\frac{1}{2}$ " x 30" aluminum pipe with aluminum cap marked as shown, 25 inches in the ground, from which;

## **NEW BEARING TREES:**

A 5/8" X 30" rebar bears N33°E, 7.32 feet with aluminum cap marked "NE RP".

A 5/8" X 30" rebar bears S51°E, 7.79 feet with aluminum cap marked "SE RP".

A 5/8" X 30" rebar bears S33°W, 8.40 feet with aluminum cap marked "SW RP".


A 5/8" X 30" rebar bears N51°W, 7.99 feet with aluminum cap marked "NW RP".

Raised a mound of stone, 4 foot base to top cap.

Buried stone east and alongside pipe.

Set a steel fence post approximately 3 feet South with BGA BT sign.

I hereby certify that the above corner point was perpetuated as hereon described on May 9, 1993.

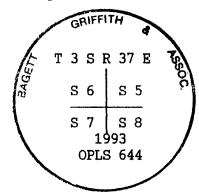

PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 10, 1964

DUANE I. GRIFFITH
644

REGISTERED

I used a steel tape and magnetic compass in the establishment of new accessories. I used 20° East magnetic declination.