

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Z-19


History of original corner establishment:

Corner established by W. B. Barr under GLO contract no. 355 dated June 14, 1880.

Surveyor General records state:

Set stake 4 ft long 4 ins diam 18 ins in ground for 1/4 Sec. Corner from which:

Pine 6 ins diam bears S36°W, 36 lks dist.
Pine 8 ins diam bears N40°W, 129 lks dist.

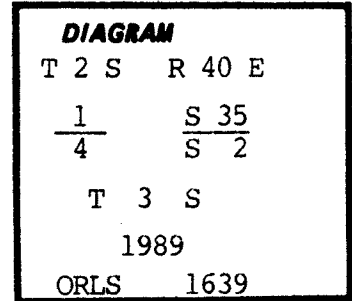

Description of corner evidence found:

Original corner or official accessories not found in area previously logged. The remnants of an ancient north-south running fence line were identified by Dean Puckett, a lifetime resident of Cove, Oregon, who assisted in the re-fencing of an existing boundary fence during the early 1930's per Mr. Puckett's testimony. Said remnants consist of barbed wire embedded in trees, old "black" U.S.F.S. boundary signs attached to snag trees and laid down and rotting wood fence posts with barbed wire attached, and later generation but very old yellow U.S.F.S. boundary signs lying on the ground alongside the fence line. The measured annual ring count of trees between the original fencing and the refencing performed by Mr. Puckett is approximately 30 years which dates the original fencing at about 1900. Close evaluation of this evidence and expert professional deliberation by this surveyor and consultant surveyors, Richard A. Chesebro, PLS 1886, and Duane I. Griffith, PLS 644, resulted in a unanimous decision that the recovered fence line should be used to fix the longitudinal position of this obliterated corner position.

Description of monument and accessories established to perpetuate the original location of this corner:

At the position established by survey longitudinally in the above described fence line and on a straight line between the recovered section corner 1/2 mile west and the recovered quarter-section corner 1 mile east...

Set a 2"x30" aluminum pipe with a 2 1/2" aluminum cap attached in a surrounding rock mound with a 6' long steel fence post alongside with a survey monument sign and a property boundary sign attached. Aluminum cap is marked as shown in corner diagram.

New bearing trees established:

A ponderosa pine 8" diam brs S33°W, 35.1' dist mkd 1/4 S2 BT.
A ponderosa pine 6" diam brs N60°E, 37.1' dist mkd 1/4 S35 BT.

Each new bearing tree has a brass washer marked PLS 1639 nailed flush to BT blaze and has survey monument sign and a bearing tree sign attached below a band of red paint. The face of the BT blaze is also painted red.

Compass declination 19° East.

I hereby certify that the above described corner monument was properly established by me on July 20, 1989, and witnessed by Patricia M. Hanley.

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

William L. Hanley

OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639

Office of..... County Surveyor..... County of..... Union
State of..... Oregon....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by.....
(COUNTY OFFICIAL)

UNION COUNTY SURVEYOR	
Date Received	<u>3-12-90</u>
Date Filed	<u>3-12-90</u>
By	<u>[Signature]</u>
File No.	<u>38-90R</u>

*GPO-591-971, 1988

A-19