CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by W. B. Barr under contract No. 355 and dated June 14, 1880.

Surveyor General records state: Marked a fir 18 ins diam for 1/4 Sec corner from which: A fir 6 ins diam brs N25 W, 38 lks dist. A fir 5 ins diam brs N41 E, 36 lks dist.

T 3 S

R 40 E | R 41 E $\frac{1}{4}$ S 12

1987

ORLS 1639

G - 25

DIAGRAM


Corner OBSERVED by Alonzo Gesner under contract No. 683 and dated June 7, 1898, and his record states: The

1/4 Sec Cor marked and witnessed as stated by the U.S. Surveyor General.

Description of corner evidence found:

Found a windblow fir corner tree $20\,^{\circ}$ dia split in half lengthwise with 1/4S on each half.

No trace of the two bearing trees.

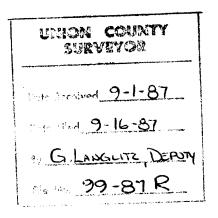

Description of monument and accessories I established to perpetuate the original location of this corner:

In the center of rotten corner tree root...

Set $2\frac{1}{2}$ " aluminum cap on 2" aluminum pipe 20" in ground & 10" projecting out of ground with surrounding rock mound & 6' fence post alongside with sign 54-9 attached. Cap marked as shown in corner diagram.

New bearing trees established: A tamarack 14" dia brs N17 $^{\rm O}$ W, 22.4' dist mkd 1/4S12 BT. A white fir 8" dia brs S77 $^{\rm O}$ W, 4.2' dist mkd 1/4S12 BT.

Each BT has a sign 54-3 and signs 54-4 or 54-9 attached below a 6" band of red paint, and each new BT has a brass washer marked PLS 1639 nailed flush with BT blaze.

Compass declination 170 East.

I hereby certify that the above described corner monument was properly remonumented by me and witnessed by Jim DeMastus on August 21, 1987.

PROFESSIONAL LAND SURVEYOR

OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639

Office of County Surveyor	County of Union
State ofOregon, I hereby certify that the within instrument was filed in this office	
for record on the dey of , 19	
by	
(COUNTY OFFICIAL)	(DEPUTY)