CERTIFIED RECORD OF LAND CORNER MONUMENTATION


HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner originally established by W. B. Barr under GLO contract no. 335, dated June 14, 1880. Surveyor General record states:

Set stake 4 ft. long 4 in. dia. 18 in ground for 1/4 Sec. Cor.

Corner was proportioned and a 2"x36" pipe with brass cap was set by Survey No. 46-79 Found by Survey No. 32-81 Found by Survey No. 55-81

Found by plat of Vista Acres
Found by plat of Vista Acres II

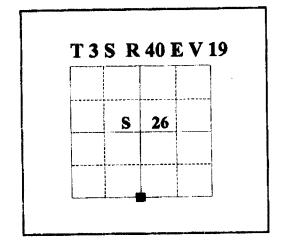

No record of subsequent monumentation found in Union County survey records.

Description of corner evidence found:

Found 2"x36" pipe with brass cap at incorrect proportionate position. sawed off the cap and chopped out the bearing trees.

See Union County Survey No. 008-2000

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER: At the true proportionate position as per Survey No. 008-2000, I set a 2%" x 30" aluminum pipe with aluminum cap marked as shown below, 36" in the ground, from which;

A 12" diameter Tamarack bears N 17°E, a distance of 80.02 feet, marked "1/4 S26 BT"

A 15" diameter Douglas Fir bears S 80°E, a distance of 63.44 feet, marked "1/4 S35 BT"

A 10" diameter Douglas Fir bears S 4°W, a distance of 48.82 feet, marked "1/4 S35 BT"

A 12" diameter Douglas Fir bears N 15°W, a distance of 80.90 feet, marked "1/4 S26 BT

REGISTERED PROFESSIONAL LAND SURVEYOR


y Ti Che, c

OREGON 15, 1973 JULY GREGORY T. BLACKMAN 991

Renewal Date: Dec. 31, 2001

I hereby certify that the above corner point was perpetuated as hereon described on September 2, 1999.

Witness: Norbert Volny, Rick Robinson

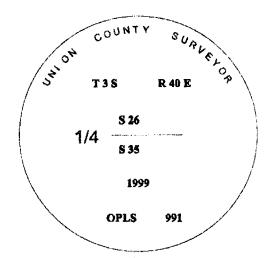

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 18° East declination, the distances are measured to a 60d spike driven in the right side of the root crown.

UNION COUNTY **SURVEYOR** 8/24/

Filed By

File Number 04-2000 R