

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


A
~~8-9~~

History of original corner establishment:

Corner established by Alonzo Gesner under GLO contract No. 683 and dated June 7, 1898.

Surveyor General records state: Set pine post 4' long 4" square 24" in ground marked T2SS33 on the NE, R41ES4 on the S, T3SS5 on the SW and S32 on the NW faces with 4 notches on E and 2 notches on W edge from which:

- White fir 10" dia brs N14°30'E, 20 lks dist mkd T3SR41ES33 BT.
- White fir 16" dia brs S47°30'E, 33 lks dist marked T2SR41ES4 BT.
- White fir 14" dia brs S61°15'W, 30 lks dist marked T2SR41ES5 BT.
- White fir 6" dia brs N28°30'W, 21 lks dist marked T3SR41ES32 BT.

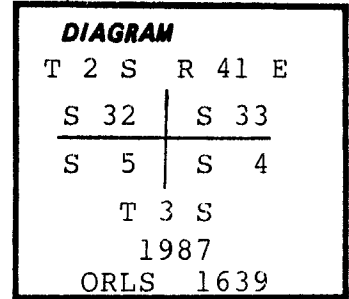

Description of corner evidence found:

- No trace of original wood post.
- A fir windblow 16" dia & root hole brs N23°E, 13.3' dist(record, N14½°E, 20 lks) with fragmentary scribes on rotten face.
- A fir windblow 22" dia & root stub brs S43°E 22.4' dist(record, S47½°E, 33 lks) with fragmentary scribes on rotten face.
- A fir windblow 22" dia & root stub brs S65°W, 19.8' dist(record, 61¼°W, 30 lks) with fragmentary scribes on rotten face.
- A fir snag 13" dia brs N26°W, 13.8'(record, N28½°W, 21 lks) with healed blaze.

Description of monument and accessories I established to perpetuate the original location of this corner:

At position determined by locus of record distances from Secs 4,5 & 32 BT remains (record position per sec 33 BT brs S74°E, 2.0' dist)...
Set 2½" aluminum cap on 2" aluminum pipe 25" in ground with 5" projecting out of ground with surrounding earth mound and 6" fence post alongside with sign 54-9 attached. Cap marked as shown in corner diagram.

- New bearing trees established:
- A spruce 11" dia brs N31½°E, 16.4' mkd T2SR41ES33 BT
 - A hemlock 10" dia brs S88½°E, 33.2' mkd T3SR41ES4 BT.
 - Alpine fir 13" dia brs S43°W, 27.3' mkd T3SR41ES5 BT.
 - Alpine fir 15" dia brs N48°W, 8.0' mkd T2SR41ES32 BT.

Each BT has a sign 54-3 and signs 54-4 or 54-9 attached below a 6" band of red paint, and each new BT has a brass washer marked PLS 1639 nailed flush with BT blaze.

Compass declination 19° East.

I hereby certify that the above described corner monument was properly remonumented by me and witnessed by Jim DeMastus on July 15, 1987.

Jim DeMastus

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

William L. Hanley

**OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639**

Office of.....County Surveyor..... County of... Union.....
State of.....Oregon....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)

**UNION COUNTY
SURVEYOR**

GPO-71311 8-12-87
8-24-87
G. LANGRIZ, DEPUTY
53-87 R