CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:	Index:	V-23
Quarter corner Sec. 25 & 36, T.4N., R.39E., W.M.	\$1954 - Military in Juliana at Military and the line of the line o	pell arkärkung f (om de film) blegge i avænk ra jor al apparations belikkel mell god n viljader, n
Original corner was set by Campbell in 1884. His record reads: Set a fir post 3' long, 3" square, 24" in the ground marked 1/4S on face. From which: A fir 18" in dia. bears S10°W 25 lks. marked 1/4S BT. A fir 6" in dia. bears N20°E 23 lks. marked 1/4S BT.	1 1 1 1	14N R39E 1 25 1 36 1 1980 1
In 1980, PLS 1097 remonumented this corner. His record	11 11	1
Found the BT southwest. At the position described above, I set a 2 1/2" x 30" the ground with a brass cap marked as shown: (see diagram which I scribed BT's: A fir 10" in diameter bears S59*W, 23.5' marked 1/4S E A fir 19" in diameter bears N15*E, 22.8' marked 1/4S E	am)	e 28" in
Description of corner evidence found: Found the iron pipe as described with brass cap stamped diagram. From which: A 26" dbh broken top Douglas Fir snag bears S7.40'W, 1 A 22" dbh Douglas Fir bears N11.53'E, 23.0' with scrib A 13" dbh Douglas Fir bears S57.34'W, 23.6' with scrib	7.2' wit	
Description of monument and accessories I established criginal location of this corner: The bearings were based on the surveyed bearing betwee the corner 1/2 mile east as recorded by PLS 1097 in Unsurvey 31-80. I set the following new witness trees: A 11" dbh Douglas Fir bears S44°52'E, 19.4' scribed 1/09" dbh Engleman Spruce bears N53°59'W, 13.7' scribed aluminum washer stamped RLS 852 is nailed between to the new trees. All the BT's have LSM and BT signs a Painted 6" red bands around all the trees and painted	n this coion Count 4 S36 BT: 1/4 S25 he letter	orner and ty
This work was done September 3, 1992. REGISTERED PROFILE AND SATURYOR LAND SATURYOR	2	
David L. Haddock		
OREGON JULY 12, 1938 DAVID L. HADDOC U5 2	sk	
Office ofCounty of		
State of I hereby certify that the within in this office for record on the by	nstrument	was filed , 19
(COUNTY OFFICIAL) US (DEPUTY)		nada an iza e na 1-miliana anizandi industria de la
Form R6-7100-57 (9/71)		

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established in 1884 by Frank W. Campbell under Contract No. 498.

40.00 ch. Set a fir post 3' long, 3" square, 24" in the ground marked 4S on North face.

From which:

A fir 18" in diameter bears S $10^{\rm O}$ W 25 lks. marked $\frac{1}{4}$ S BT. A fir 6" in diam. bears N $20^{\rm O}$ E 23 lks. marked $\frac{1}{4}$ S BT.

-	V-8	23	
DIAGR	AM		
1/4	36		

Description of corner evidence found:

Found the BT Southwest.

Description of monument and accessories I established to perpetuate the original location of this corner

At the position described above, I set a $2\frac{1}{2}$ " x 30" iron pipe 28" in the ground with a brass cap marked as shown:

From which I scribed BTs:


A fir 10" in diameter bears S 59 0 W 23.5' marked $\frac{1}{4}$ S BT. A fir 19" in diam. bears N 15 0 E 22.8' marked $\frac{1}{4}$ S BT.

I nailed a brass washer marked OPLS 1097 to BT blazes.

I set a steel fence post 5 feet West.

I painted a red band around BTs and face of scribe.

I used a steel tape and magnetic compass with 19 East variation and measured a horizontal distance to the center of the BTs. This corner was set April 17, 1980. Witness by Patrick L. Murphy. See map of survey.

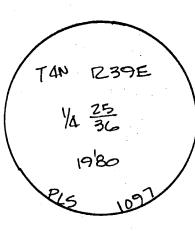

REGISTERED **PROFESSIONAL** LAND SURVEYOR

OREGON JULY 22, 1977 JAMES H. BUISMAN

Office of Lewis Country of Ones	
State of Qt. C. C	fice
for record on the 20 day of	•••••

Form R6-7100-57 (9/71)

UNION COUNTY SURVEYOR			
Date Received	-		
Date Filed	-	GPO	796 -333
	_		

File No. 19-83 R