CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by Frank Campbell under GLO Contract #507 in 1884.

A Tamarack 10" dia, marked T 4N, S 20 on NE, R 40E S 29 on SE, S 30 on SW and S 19 on NW faces with 2 notches on S and 5 notches on E from which:

A Tamarack 20 in dia. N 35E 12 lks.

A Tamarack 20 in dia. S 47E 17 lks.

A Tamarack 12 in dia. S 55W 40 lks.

A Tamarack 18 in dia. N 50W 23 lks.

DIAGRAM R 40E T4N

Description of corner evidence found:


Brass Cap set 26" in ground stamped:

A standing dead fir 14" dia. bears S 26W 8.40 ft. A down fir 12" dia. bears N 31E 16.90 ft.

A standing dead fir 10" dia. bears N 30W 7.80 ft.

A down fir 12" dia. bears S 82W 30.70 ft.

 4×4 wood post 5' North with attention signs.

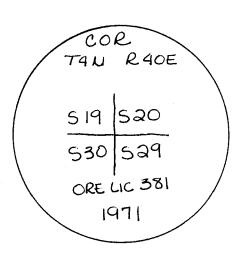

Description of monument and accessories I established to perpetuate the original location of this corner:

A 22" Fir bears N 31° W 180.0' mkd T 4N R 40E S 19 BT A 14" Fir bears S 67°_{\circ} W 222.80' mkd T 4N R 40E S 30 BT A 18" Fir bears N 74° E 265.50' mkd T 4N R 40E S 20 BT

A 5/8" x 30" Iron Rebar with an aluminum cap stamped "B.O." bears S 51° E 61.5 feet with a fence post 1° North.

No tree available in sec. 29.

Blazes are painted red, trees have red bands painted around them and have signs 54-3, 54-4, 🐔 Suppose and open strangers (S)

November 1982

By: W. Keith Sands

Witness: Rodney D. Punches

Brent J. Reynolds

(COUNTY OFFICIAL)

REGISTERED PROFESSIONAL AND SURVEYOR

OREGON JULY 17, 1970 DAVID H. KRUMBEIN

Office of County Surveyor County of Union	
State of Oregon , I hereby certify that the within instrument was filed in this office	···
for record on the day of , 19	UNION COUN
by	SURVEYOR

Form R6-7100-57 (9/71)

SEE SURVEYS-37-83 - 38-83

(DEPUTY)

Date Received 9-26-83

COUNTY

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

	R-5
History of original corner establishment: Corner established in 1884 by General Land Office (contract survey)	DIAGRAM T4N R40EWM
Original survey notes read; A tamarack tree for the corner from which; A tamarack 18" in diam bears N50°W 23 1ks dist marked TWN R40E S19BT;	S19 S20 S30 S29
A tamerack 20" in diam bears N35°E 12 lks dist. marked T4N R40E S20BT;	1
A tamarack 20° in diam bears S47°E 17 lks dist marked T48 R40E S29BT;	
A tamarack 12" in diam bears S55°W 40 lks dist marked T4N R40B	: S30BT;

Description of corner evidence found:

At the corner we found four down tamarack trees.

At \$50°W a tamarack log with full scribe. The stump of the tree still in place.

At N35°E a tamarack log down with scribe.

At 347°E found a rotten log with partial scribe visible.

At 955°W found a rotten log with full scribe visible.

No evidence of the tree for the corner was found.

Description of monument and accessories i established to perpetuate the

eriginal location of this corner
At the position of the corner I placed a galvanized iorn pipe 30" long
with an eight inch plate welded to bottom and a bronze cap on top.
The pipe was set to a depth of 24 inches and back filled with tamped
earth.

 T4N R40E 319 | S20 S30 | S29 ORE LIC 381 1971

COR

13" in diam bears \$26°E a distance of 8.4 ft scribed T4N R40E \$29BT;
A white fir 10" in diam bears \$82°W a distance of 30.7 ft. scribed T4N R40E \$30BT;
All distances are measured to center of respective trees. I placed a treated wood post near the corner with USFS sign 54-4 attached. I placed USFS bearing tree signs on the four down bearing trees and placed the sign on the new trees breast high facing the corner.

Office of County, Surveyor	County of.	Union		
State of Oragon , I hereby certify	that the with	hin instrument	was filed in	n this office
for record on the19 day ofJuneCounty surveyor	<i>:::</i> 19	971, 98	o'clocky.	.m., (signed)
county surveyor	by X a	mild C/C	and the	
(COUNTY OFFICIAL)		(DEPUT	(A)	

Form R6-7100-57 (9/66)

UNION COUNTY SURVEYOR
Date Received
Date Filed
Ву
File No. 60-83 R

James & Book