

OREGON CORNER RESTORATION FORM

Section: 2
Township: 4S
Range: 35 EWM
County: UNION
Date: 03/10/98
Corner Designation: C-21

Previous Renewals/Surveys, etc.: This corner was originally set by U.S. Deputy Surveyor Rufus S. Moore under his contract No. 451, dated June 12, 1882. The Surveyor Generals notes state; "Set a post 3 ft. long 3 ins. sq. 24 ins. in the ground for 1/4 sec. cor. marked 1/4 S on W. face, from which; A pine 48 ins. in dia bears N47°E 94 lks. dist. marked 1/4 S BT. A pine 36 ins. in dia bears N3°W 336 lks. dist. marked 1/4 S BT.

Monument(s) & Accessories Found (Condition & Source): Found a 2½" galvanized iron pipe set in concrete protruding 36" from the ground leaning to the Southwest. A 48" pine stump bears N45°E 62 feet.

Monument Detail: TOMKINS SURVEYING
T4S R35E
1/4 S2 + S1
1998
WA25893 OR2360 OR2820

Monument Set (Procedures & Description):

At the location of the iron pipe set a 5/8" x 30" rebar 28" in the ground surrounded with a mound of stone, with a 1½" aluminum cap stamped as shown attached.

New Accessories:

A 5/8" rebar with a yellow plastic cap stamped "Tomkins Surveying" set at the N.E. corner of parcel 2 of Union County Partition plat No. 1994-28 bears N00°11'36"E 375.00 feet.
A ½" rebar with a yellow plastic cap stamped "Tomkins Surveying" bears S51°46'E 23.82 feet.
A 2½" aluminum monument marking the south 1/16 corner between sections 1 & 2 bears S00°46'34"W 1323.26 feet.
A ½" rebar with a yellow plastic cap stamped "Tomkins Surveying" bears S62°41'W 18.75 feet.
A large pile of rocks is 3' Southwest of the corner.

Location & Comments:

The corner is located on an open gentle North slope.

Compass Declination:

19° East


Surveyor's Seal

Firm/Agency: Tomkins Land Surveying, Inc.
20 E. Poplar, Suite 204
Walla Walla WA 99362

Party Chief: Greg E. Flowers

Notes: Greg E. Flowers

Witness: Brianna Slater

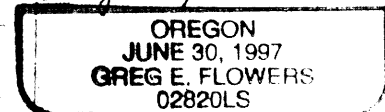

RENEWS 12/31/99
5/14/98

6/22/98
8/29/98
R. ROBINSON, DEPUTY
046-1998R