

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:
Corner has not been previously set.

DIAGRAM
T4S R35E

C1/4 S17

1989
PLS 699

Description of corner evidence found:
Corner is being set by this survey.

UNION COUNTY SURVEYOR	
Date Received	<u>9-25-89</u>
Date Filed	<u>9-25-89</u>
By	<u>G. LANGLITZ</u>
File No.	<u>186-89 R</u>

Description of monument and accessories I established to perpetuate the original location of this corner:



Set a 2"x30" aluminum pipe with a 2 1/2" aluminum cap, marked as shown in the diagram, 14" in the ground to solid rock, at a point as determined by the procedures set forth in the MANUAL OF INSTRUCTIONS FOR THE SURVEY OF PUBLIC LANDS for the subdivision of sections. Built a mound of rock to be 36" in diameter by 16" high around the monument, from which new BTs are:

11" Ponderosa pine bears N20° 45'E, 79.0 feet scribed C1/4 S17 BT

10" Ponderosa pine bears N81° 45'E, 73.2 feet scribed C1/4 S17 BT

Attached BT and Land Survey Monument signs to and painted a red band around each BT. Bearings were turned from the control traverse with a theodolite, basis of bearing being the bearing between the SE and S quarter corners of Section 7 as shown on MOS 43-76, to stamped brass washers nailed in the scribed red-painted blazes. Distances were measured from a 60d spike, with an aluminum washer stamped PLS 699, which was driven into the side of each BT approximately one foot above the ground. Set a steel fence post 5 feet S of the corner with a Land Survey Monument sign attached. The monument is not a National Forest property corner.

I, Leland L. Myers, P.O. Box 98, Sumpter, OR 97877, do hereby certify that on July 18, 1989, I established the corner as herein described.

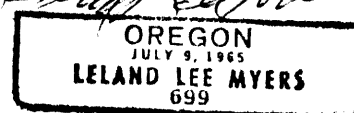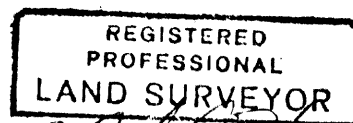

FILED

IN THE OFFICE OF THE UNION COUNTY SURVEYOR
THIS ____ DAY OF _____, 19__

Union County Surveyor