
History of original corner establishment:
Corner not previously established.

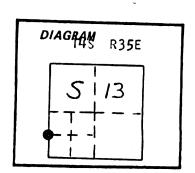

Description of corner evidence found:

None

## UNION COUNTY SURVEYOR

Date Received 12-5-85

Date Filed 12-6-85

BY G. LANGLIE DEPUT

File No. 140-85 R

See map of survey dated November 1985.

Description of monument and accessories I established to perpetuate the original location of this corner:


At position determined by survey I set a  $2^{1}2^{1}\times30^{11}$  aluminum pipe with aluminum cap marked as shown, 22 inches in the ground with surrounding mound of stone from which:

A 5/8'x30" iron pin with plastic cap marked BGA Survey Marker bears \$46°E, 10.02 ft.

A 5/8"x30" iron pin with plastic cap marked BGA Survey Marker bears \$300 W , 11.37 FT.

Set a steel fence post approximately 5 feet South with a 54-4 and 54-2 sign attached.
Set a steel fence post approximately 5 feet West with a 54-2 sign attached.

Corner set 10/14/85 Witness: Greg Blackman, Stratton French

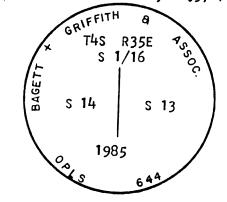

PROFESSIONAL LAND SURVEYOR

OREGON
JULY 10, 1964

DUANE 1. GRIFFITH
644

REGISTERED

Brass washer nailed to BT blaze.
Used steel tape and magnetic compass with 20° East declination. Measured to 50d spike set in right side of tree when facing tree, unless otherwise stated.

Office of	County of
State of / hereby certify i	County ofhat the within instrument was filed in this office
(COUNTY OFFICIAL)	(DEPLITY)

Form R6-7100-57 (9/71)

\$U.S. GOVERNMENT PRINTING OFFICE - 1983-793-276
M-21