


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. J-3

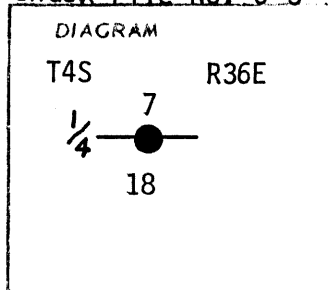

History of original corner establishment:

Record of the original survey by H. Gradon,
Contract No. 452, 1882, states:

Set a post 3 ft. long, 3 ins. square, 24 ins. in the ground, for 1/4 sec. cor, marked 1/4S on N. Face, from which:

A Fir, 24 ins. diam. bears N 15°E 16 lks. dist., marked 1/4S BT,

A Pine 7 ins. diam. bears S50°W, 20 lks. dist., marked 1/4S BT.

Description of corner evidence found:

None

Description of monument and accessories established to perpetuate the original location of this corner

At surveyed point set 2 1/2" x 30" galvanized pipe with brass cap stamped:

T4S R36E

Set pipe 22" in ground with mound of stone to cap.
New BT's:

1/4 S7
 +
 S18

A Doug. Fir 9" dia bears N75°W, 20.7 ft scribed 1/4S7 BT
A Pond. Pine 10" dia bears S64°E, 32.6 ft scribed 1/4S18 BT

PLS 1099
1980

Attached 54-3 & 54-4 signs to both BT's. Attached brass washer stamped LS 1099 to foot blaze of both BT's. Painted blazes & 6" band around both BT's red. Attached 54-4 sign to metal post 5' East of corner.

Corner falls on slight East slope in logged area approx. 300' West of N-S New logging road.



Compass Declination: 18° 15' East
Witnesses: Rodger Orton
 Alan Hanley

I hereby certify that the above described corner and/or accessories was established on Oct. 20, 1980.

Office of County Surveyor County of Union
State of Oregon, I hereby certify that the within instrument was filed in this office for record on the _____ day of _____
_____ by _____
(COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR

Date Received _____

Date Filed _____

By _____

File No. 470-84R