


Index File No. P17 CORNER RECORD (SEARCH) (Ref. FSM 7151.4) Tract or Survey No. _____ Cor. No. _____
 T 75 R. 36E R.D. LAGRANGE County UNION
 Merid. will N.F. W-W State OR.

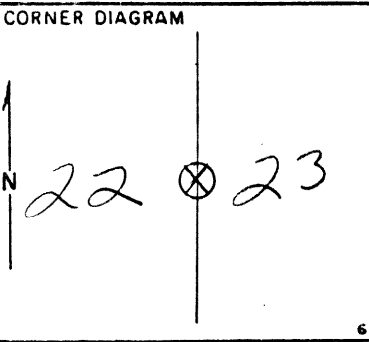

DESCRIBE CORNER MONUMENT FOUND
 STONE WHICH FITS NOTES BUT
 NO MARKS FOUND

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND
 FOUND TREES WITH "OCELY" SEARS
 WHICH FIT NOTES. NEED TO CUT
 OPEN TO VERIFY!

PHOTO IDENTIFICATION DATA
 Photo No. _____
 Filed At. _____
 Object Ident. _____
 Ident. By _____
 Signature _____

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

PLANE COORDINATE POSITION DATA
 State _____ Zone _____
 X _____
 Y _____
 Estab. By _____
 Agency _____

Signature JAMES LUSHER Title _____ Division _____ Headquarters 6/86 Date _____ FS-7100-52 (3/68)

UNION COUNTY SURVEYOR

Date Received _____
 Date Filed 12-21-87
 By G. LANGLITZ, DEPUTY
 File No. 307-87R

P-17

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T 4S, R 36E. , W.M.

Corner Code No. P-17


Note: Monument marked as shown below

History of original corner establishment:

This corner was originally established by Herman D. Gragon, U.S. Deputy Surveyor, under Contact No. 452, dated June 16, 1882. The original notes state that at the corner a 18 by 12 by 9 inch basalt stone, marked "1/4" on west face, was set 12 inches in the ground from which:

A pine 15 ins diam bears N80°E 116 lks dist. marked 1/4 S. BT.

A fir 12 ins diam bears N75°E 93 lks dist., marked 1/4 S. BT.

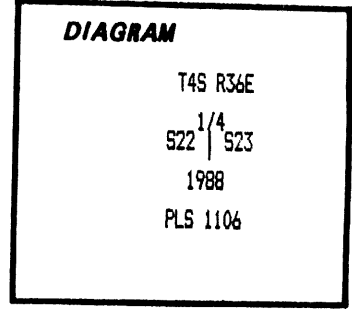

Corner No.
Compass Declination: 19.0°E

Description of corner evidence found:

Found a 19" by 12" by 10" basalt stone setting upright in a stone mound, marked "1/4" on west face, from which:

A 23" ponderosa pine stump bears N86°E 69.3'. (Original bearing tree). This tree has been cut within the last couple of weeks by helicopter logging crews. The tree was observed by me, standing with a healed blaze, on October 6th, 1988. The tree was flagged by me on October 6th, with ribbon marked "Bearing tree, Do Not Cut", but the loggers cut it anyway.

A 20" live douglas fir bears N75°W 63.0' (Record N75°E 93 lks), with healed blaze. (Original bearing tree).

Description of monument and accessories established to perpetuate the original location of this corner:

At the position of the found original stone, set a 2 1/2" BY 30" aluminum pipe with 2 1/2" aluminum cap, 18" in the ground to bedrock and surrounded with a mound of earth and stone. Buried the corner stone in the new mound. Marked one new bearing tree:

The 12" main stem of a mountain mahogany leaning south bears S74°W 19.7', scribed 1/4 S22 BT. (Measured to centerline of root crown where the tree enters the ground).

The fir trees in this area are damaged by spruce budworm, and there are no convenient pines for reference to the East so I mark a bearing object: On a 10" by 10" by 12" out of ground rock outcrop, I chisel "X 80" on the North face. The "X" bears S 35 1/2°E 24.5' from the new monument. Painted the "X 80" marks with red paint.

The new bearing tree has a brass washer stamped PLS 1106 nailed to the face of blaze. Attached sign 54-3 and 54-9 and painted face of blaze and a 6" red band around each bearing tree. Set steel fence post North of corner and attached sign 54-9.

UNION COUNTY SURVEYOR	
Date Received	<u>1-5-89</u>
Date Filed	<u>1-6-89</u>
By	<u>G. LANGLITZ, DEPUTY</u>
File No.	<u>4-89 R</u>

REGISTERED PROFESSIONAL LAND SURVEYOR
<i>William R. Wells</i>
OREGON JULY 22, 1977 WILLIAM R. WELLS 1106

Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)