

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

G-13

History of original corner establishment:


Corner originally established by Herman Gradon under Contract No.452, dated June 16, 1882.

Surveyor General records state:

Set a basalt stone 14 x 14 x 7 ins 9 ins in the ground for 1/4 Sec Cor marked 1/4 on W face from which:

A pine 11 ins diam bears N40°E, 60 lks dist marked 1/4S BT.

A pine 24 ins diam bears S68°W, 10 lks dist marked 1/4S BT.

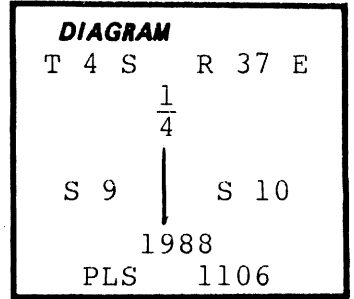

Description of corner evidence found:

Found a 12 x 10 x 8" basalt stone marked with poor "1/4" on West face from which:

A root hole depression brs S68°W, 6.6', no other traces remain of the original BTs.

UNION COUNTY SURVEYOR	
Date Received	<u>1-5-89</u>
Date Filed	<u>1-6-89</u>
By	<u>G. LANGLITZ, DEPUTY</u>
File No.	<u>5-89 R</u>

Description of monument and accessories I established to perpetuate the original location of this corner:

At position of found stone...

Set a 2 1/2" aluminum cap on 2 1/2 x 30" aluminum pipe 24" in ground, surrounded with mound of earth and stone & 6' steel fence post North of corner with sign 54-9 attached. Cap marked as shown in corner diagram. Buried corner stone in mound.

New bearing trees established:

A 10" ponderosa pine brs S9°E, 115.4' scribed 1/4S10 BT.

A 14" ponderosa pine brs N54 1/2°W, 59.9' scribed 1/4S9 BT.

New BTs have a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-9, painted face of blaze & a 6" red band around each BT.

Compass declination 19° East.

I hereby certify that the above corner monument was properly remonumented to U.S.F.S. standards by me on October 07, 1988.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

Office of.....County Surveyor..... County of..... Union
Oregon
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)