## ERTIFIED RECORD OF LAND CORNER MONUMEN ... ATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner not previously established

DESCRIPTION OF CORNER EVIDENCE FOUND:

None

See Union County Survey Number 013-2009

Description of monument and accessories I established

To perpetuate the original location of this corner:

To perpetuate the original location of this corner: At position determined by survey, I set a 5/8" x 30" iron pin, with 2 ½" aluminum cap marked as shown, 14" in the ground, with mound of stone 2 1/2 ft. wide, from which:

- A 11 inch Douglas Fir bears South  $70^{\circ}$  West, a distance of 47.76 feet, marked CW 1/16 S10 BT.
- A 15 inch Ponderosa Pine bears North  $32^{\circ}$  West, a distance of 52.48 feet, marked CW 1/16 S10 BT.


I set a steel fencepost 2 feet South of the corner.

I hereby certify that the corner was monumented on June 11, 2009 Witness: Jeff  ${\tt Hsu}$ 

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
July 17, 1986
RICK G. ROBINSON
2219

Renewal Date: December 31, 2010

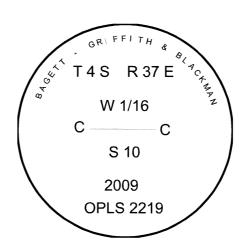

T4S R37E G-14

10

S

UNION COUNTY
SURVEYOR

Date Received 6/25/69

Date Filed 6/29/69

Filed By 7.86...

File Number 025 7009 R

I used a steel tape and magnetic compass in the establishment of the accessories. Magnetic declination is 18° East. I attached a brass washer marked OPLS 2219 to the BT blaze. The distance is to a 60d spike driven into the root crown at the right side of the bearing trees.