


Index File No. J-19
T 4 S R. 37 E
Merid. Willamette

CORNER RECORD (SEARCH)

Tract or Survey No. _____ Cor. No. _____

R.D. LaGrande County Union
N.F. W-W State Oregon

CORNER DIAGRAM

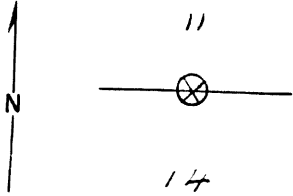

DESCRIBE CORNER MONUMENT FOUND

None
Lost because of creek channel change

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

Sec. 11 - 36' W.F. Live, Fair condition, scribe grown over

PHOTO IDENTIFICATION DATA

Photo No. _____
Filed At. _____
Object Ident. _____
Ident. By _____
Signature

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

PLANE COORDINATE POSITION DATA

State _____ Zone _____
X _____
Y _____
Estab. By _____
Agency

Signature David L. Dahlstrom Title C.E.T. Division _____ Headquarters LaGrande Date 9-11-78

7100-52
REV. 65 5

UNION COUNTY SURVEYOR
Date Received _____
Date Filed 12-21-87
By G. LANGLITZ, DEPUTY
File No. 318-87R

J-19

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

J-19

History of original corner establishment:


Corner originally established by Herman Gradon under Contract No.452, dated June 16, 1882.

Surveyor General records state:

Set a basalt stone 26 x 8 x 8 ins 15 ins in the ground for 1/4 Sec Cor marked 1/4 on N face from which:

A fir 20 ins diam bears N25°E, 19 lks dist marked 1/4S BT.

An alder 4 ins diam bears S10°E, 25 lks dist marked 1/4S BT.

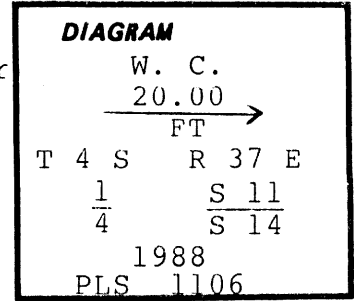

Description of corner evidence found:

No trace of original corner stone.

A 40" white fir brs N25°E, 12.5' to face of blaze and 13.3' to center of tree.

UNION COUNTY SURVEYOR	
Date Received	<u>1-5-89</u>
Date Filed	<u>1-6-89</u>
By	<u>G. LANGRISH Deputy</u>
File No.	<u>10-89 R</u>

Description of monument and accessories I established to perpetuate the original location of this corner:

The corner point was reestablished by measuring S25°W, 12.5' from face of blaze of original BT. The corner point falls in the middle of Little Rock Creek, so at a point N89°56'17"W, 20.00' from cor. I set a witness corner monument. At this point...

Set a 2½" aluminum cap on 2½ x 30" aluminum pipe 22" in ground, surrounded with mound of earth and stone & 6' steel fence post North of corner with sign 54-9 attached. Cap marked as shown in corner diagram.

New bearing trees established:

A 12" western larch brs N22°W, 98.6' scribed "X" at breast height and "BT" at base.

A 9" western larch brs S19½°W, 24.0' scribed "X" at breast height and "BT" at base.

Placed 54-3 tags on the original BT for both the corner point and witness corner monument. Attached sign 54-4 to original BT.

New BTs have a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-9, painted face of blaze & a 6" red band around each BT.

Compass declination 19° East.

I hereby certify that the above corner monument was properly reestablished to U.S.F.S. standards by me on October 24, 1988.

REGISTERED PROFESSIONAL LAND SURVEYOR

Will. R. Wells

OREGON JULY 22, 1977 WILLIAM R. WELLS 1106

Office of..... County Surveyor..... County of..... Union.....
 State of..... Oregon....., I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....
 by
 (COUNTY OFFICIAL) (DEPUTY)