

**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

T 4S, R 37E., W.M.


Corner Code No. N-9

Note: Monument marked as shown below

**History of original corner establishment:**

This corner was originally established by Herman D. Graddon, U.S. Deputy Surveyor, under Contract No. 452, dated June 16, 1882. The original notes state that at the corner a 14 by 14 by 8 inch basalt stone, marked T4S R37E S16 on NE, R37E S21 on SE, S20 on SW and S17 on NW faces, with 3 notches on S and 4 notches on E edges, was set 9 ins. in the ground from which:

- A tamarack 10 ins diam. bears N62°E 57 lks dist., marked T4S R37E S16 BT.
- A tamarack 6 ins diam. bears S65°E 67 lks dist., marked T4S R37E S21 BT.
- A pine 30 ins diam bears S35°W 59 lks dist., marked T4S R37E S20 BT.
- A tamarack 14 ins diam. bears N20°W 30 lks dist., marked T4S R37E S17 BT.

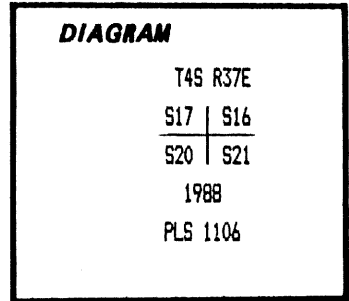

Corner No.  
Compass Declination: 19.0°E

**Description of corner evidence found:**

- A 12" diameter chunk of down rotted western larch, with visible scribes, bears N64°E 37.6' to face of blaze and 38.2' to centerline of stump hole. (Original bearing tree).
  - A 30" burnt ponderosa pine snag 8' high, bears S37°W 38.9' to face of blaze and 40.2' to centerline, with visible scribes. (Original bearing tree).
  - A 10" diameter chunk of down rotted western larch bears N20°W 48.0' to stump hole with visible scribes. (Original bearing tree).
- No trace of the original stone was found.

**Description of monument and accessories established to perpetuate the original location of this corner:**

Reestablished corner position by measuring record distance from the Northeast and Southwest bearing tree remains, measuring from the face of blaze. Record distance from the Northwest original bearing tree remains was rejected because it did not match measurements from the Southwest and Northeast bearing tree remains. At the reestablished corner position, set a 2 1/2" by 30" aluminum pipe with 2 1/2" aluminum cap, 22" in the ground and surrounded with a mound of earth and stone. Established 4 new bearing trees:

- A 6" lodgepole pine bears N57°E 10.1' scribed T4S R37E S16 BT.
- A 15" douglas fir bears S41 1/2°E 35.4' scribed T4S R37E S21 BT.
- A 27" ponderosa pine bears S58°W 135.6' scribed T4S R37E S20 BT.
- A 10" western larch bears N56 1/2°W 47.5' scribed T4S R37E S17 BT.

New bearing trees have a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 and 54-9 and painted face of blaze and a 6" red band around each bearing tree. Set steel fence posts east and west of corner and attached sign 54-2 to both posts and sign 54-9 to both posts.

|                                  |
|----------------------------------|
| <b>UNION COUNTY<br/>SURVEYOR</b> |
| Date Received <u>1-5-89</u>      |
| Date Filed <u>1-6-89</u>         |
| By <u>G. LANGLITZ, DEPUTY</u>    |
| File No. <u>24-89 R</u>          |

|   |
|---|
| REGISTERED<br>PROFESSIONAL<br>LAND SURVEYOR         |
| <i>Will. R. Wells</i>                               |
| OREGON<br>JULY 22, 1977<br>WILLIAM R. WELLS<br>1106 |

Office of..... County of.....  
 State of....., I hereby certify that the within instrument was filed in this office  
 for record on the..... day of....., 19.....  
 ..... by .....  
 (COUNTY OFFICIAL) (DEPUTY)