


Index File No. N-15 CORNER RECORD (SEARCH) (Ref. FSM 7151.4) Tract or Survey No. _____ Cor. S. 1/4 COR.
 T 4S R. 37 E R.D. LA GRANDE County UNION No. SEC. 15
 Merid. WILLAMETTE N.F. WALLOWA-WHITMAN State OREGON

CORNER DIAGRAM

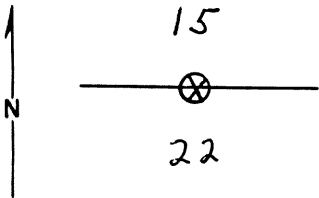

DESCRIBE CORNER MONUMENT FOUND

NONE

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

20" Douglas Fir, with blaze marking not visible.
16" Douglas Fir, scribing visible 1/4 S B.T.

PHOTO IDENTIFICATION DATA

Photo No. _____
 Filed At. _____
 Object Ident. _____
 Ident. By _____
Signature

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

Corner located about 500' west of High Rock Bluff. Bluff is visible from road which is signed as thru road.

PLANE COORDINATE POSITION DATA

State _____ Zone _____
 X _____
 Y _____
 Estab. By _____
Agency

Signature AJB Title _____ Division _____ Headquarters _____ Date 6/74 7100-52 (3/68)

UNION COUNTY SURVEYOR
 Date Received _____
 Date Filed 12-21-87
 By G. LANGUITZ, DEPUTY
 File No. 321-87R

N-15

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

N-15

History of original corner establishment:


Corner originally established by Herman Gradon under Contract No.452, dated June 16, 1882.

Surveyor General records state:

Set a basalt stone 12 x 12 x 4 ins 8 ins in the ground for 1/4 Sec Cor marked 1/4 on N face from which:

A fir 15 ins diam bears N20°W, 9 lks dist marked 1/4S BT.

A fir 8 ins diam bears S60°E, 21 lks dist marked 1/4S BT.

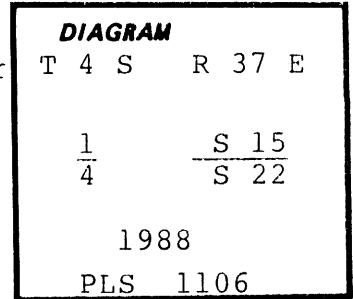

Description of corner evidence found:

Found a 14 x 12 x 3" basalt stone (broken) no marks visible, lying on ground from which:

A 22" douglas fir brs N7°W, 5.9' to face of blaze and 6.6' to center of tree with healed blaze.

A 18" douglas fir brs S64°E, 13.9' to face of blaze and 14.5' to center of tree with scribing visible on partially healed blaze.

Description of monument and accessories established to perpetuate the original location of this corner:

Re-established corner position by measuring record distances from face of blazes on the original BTs.

The corner point falls on solid rock 1" below ground level. Instead of a pipe monument I set a 3" brass disc in mortar in a hole drilled in the rock. Surrounded the brass disc with rocks, including the corner stone. Disc marked as shown in corner diagram. Set 6' steel fence post 3.5' West of corner & attached sign 54-9.

New bearing trees established:

A 28" ponderosa pine brs N40°W, 34.9' scribed 1/4S15 BT.

A 20" ponderosa pine brs S19°W, 25.4' scribed 1/4S22 BT.

New BTs have a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-9, painted face of blaze & a 6" red band around each BT.

Compass declination 19° East.

I hereby certify that the above corner monument was properly re-established to U.S.F.S. standards by me on October 25, 1988.

REGISTERED PROFESSIONAL LAND SURVEYOR

William R. Wells

OREGON JULY 22, 1977 WILLIAM R. WELLS 1106

Office of..... County Surveyor..... County of..... Union.....

State of..... Oregon....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR
Date Received <u>1-5-89</u> <small>GPO-591-971-1988</small>
Date Filed <u>1-6-89</u>
By <u>G. LANGUTZ DEPUTY</u>
File No. <u>27-89 R</u>