

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

R-25

History of original corner establishment:

Corner established in 1882 by Herman D. Gradin under
General Land Office Contract No. 452.


Surveyor General Record states:

Set post for corner from which;

A pine 8 in. dia. bears S40W, 22 links

A pine 9 in. dia. bears N30W, 26 links

The old Section corner bears South, 2.12 chains

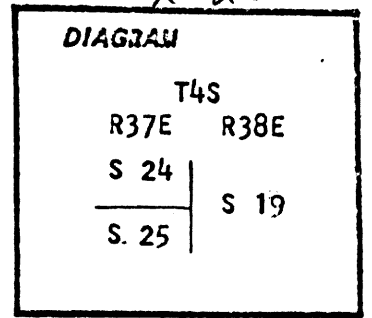

No record of subsequent remonumentation found in County records.

Description of corner evidence found:

ORIGINAL BTs

A pine stump, rotted out, bears S40W, 14.5 feet, bits of scribes visible

A pine 10 in. dia., dead and down, loose on ground at approximate
position N30W, 17 feet, scribes visible

Old corner bears South 141.1 feet

See map of survey dated June 1980.


Description of monument and accessories I established to perpetuate the
original location of this corner:

At a point established at the intersection of the range line and
a line from the $\frac{N}{4}$ corner of Section 25 to the record position
from BT, I set a $2\frac{1}{2}$ " x 30" iron pipe with brass cap marked as
shown, 26" in ground, from which:

A 12 in. dia. fir bears S35W, 33.5 feet marked T4S R37E S25 BT.

A 9 in. dia. fir bears N28W, 18.2 feet marked T4S R37E S24 BT.

The Southwest corner of Section 19 bears South 141.02 feet.

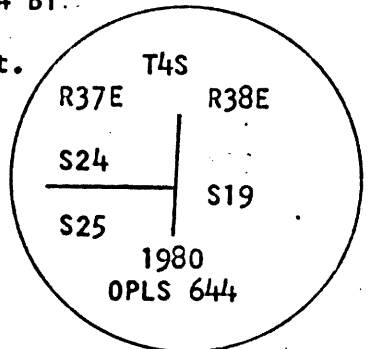

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

Doane L. Griffler
DOANE L. GRIFFLER
844

Brass washer nailed to B.T. blaze.
Used steel tape and magnetic compass
with 18° East declination.
Measured to center of all B.T.s

Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office

for record on the..... day of....., 19.....

..... by

(COUNTY OFFICIAL)

(DEPUTY)

**UNION COUNTY
SURVEYOR**

Date Received _____

Date Filed ★ GPO-700-278 _____

By _____

File No. 509-84R