

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


V-21

History of original corner establishment:

Corner established in 1832 by Herman D. Gradin under General Land Office Contract No. 452.

Surveyor General Record states:

- Set post for corner from which;
- A tamarack 10 in. dia. bears N35E, 15 links
- A pine 10 in. dia. bears S55E, 44 links
- A spruce 6 in. dia. bears S20W, 7 links
- A spruce 12 in. dia. bears N55W, 24 links

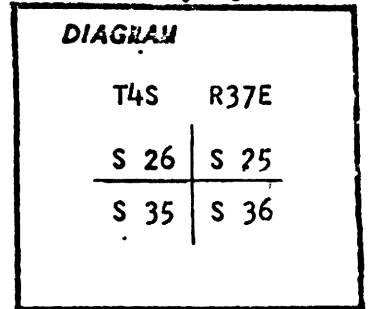

No record of subsequent remonumentation found in County records.  
Description of corner evidence found:

NONE- However at approximate double proportionate distances I set from creek calls.  
I place corner at proportionate distance North and South, and find a spring call distance North. I place corner call distance East of creek as called, I also find blaze line approximately 400 feet South, which agrees with East-West position

See map of survey dated June 1980.


Description of monument and accessories I established to perpetuate the original location of this corner:

At corner position I set a 2½ inch x 30 inch iron pipe with brass cap marked as shown, 26 inches in the ground from which;

NEW BTs

- A 5 in. dia. fir bears N71E, 29.7 feet marked X BT
- A 12 in. dia. fir bears S89E, 1.5 feet marked T4S R37E S36 BT
- A 11 in. dia. fir bears S25W, 47.0 feet marked T4S R37E S35 BT
- A 12 in. dia. spruce bears N70W, 24.0 feet marked T4S R37E S26 BT

Raised mound of stone

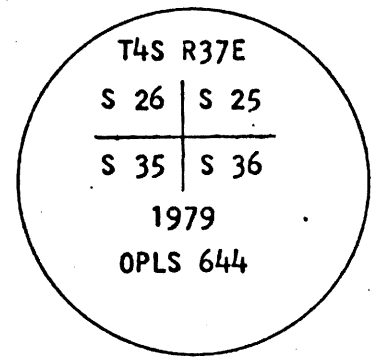

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON JULY 19, 1964 DUANE L. GRIFFITH 6-4

Brass washer nailed to B.T.blaze. Used steel tape and magnetic compass with 18° East declination. Measured to center of all B.T.s

Office of..... County of.....  
State of..... I hereby certify that the within instrument was filed in this office  
for record on the..... day of....., 19.....

..... by .....  
(COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR

Date Received \_\_\_\_\_

Date Filed ☆ GPO-700-270 \_\_\_\_\_

By \_\_\_\_\_

File No. 515-84R