


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

C-1

History of original corner establishment:

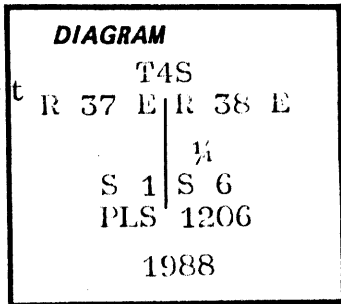

The original survey was performed by T. Lavenport under GLO contract No. 102 dated July 20, 1863. GLO record states:

Set post, from which:

A pine 14" dia. bears S 55 W, 75 lks.

A pine 30" dia. bears N 55 E, 37 lks.

Description of corner evidence found:

Found an 8" dia. rotted and sawed stump, bears S 55 W 49.5 ft. marked /BT

A 28" dia. Ponderosa Pine snag bears N 55 E, 24.4 ft. marked (BT on partially healed blaze.

Description of monument and accessories I established to perpetuate the original location of this corner:

At the corner point as reestablished from the two original bearing trees, set 2 1/2" brass cap on 1 1/4" dia. galv. iron pipe, 30" long, 20" into the ground.

From the corner point:

A 17" dia. Douglas Fir bears N 10 E, 31.3 ft. dist. marked 1/4 S6 BT.

A 14" dia. Douglas Fir bears S 64 E, 49.1 ft. dist. marked 1/4 S6 BT.

Set a steel fence post alongside the monument, painted the blazes on the bearing trees red, and attached a brass I. L. washer between the B and T scribes.

I certify the above monument and references were properly established under my supervision July 28, 1988 and witnessed by Tom Fisk, Larry McBroom and Andy Marlette.

Office of..... County of.....
State of..... I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....

(COUNTY OFFICIAL)
REGISTERED
PROFESSIONAL
LAND SURVEYOR

(DEPUTY)

Form R6-7100-57 (9/71)

James D. Hanley
OREGON
SEPTEMBER 23, 1977
JAMES D. HANLEY
1206

UNION COUNTY SURVEYOR	
Date Received	<u>5-1-89</u>
<small>★ GPO—798-276</small>	
Date Filed	<u>5-15-89</u>
By	<u>G. LANGLITZ, DEPUTY</u>
File No.	<u>108-89R</u>