CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. A-21 (T.4S., R.40E.)

History of original corner establishment:


Record of the original survey of the North Bdy. of T4S, R40E by Davenport, 1863, states:

Set post corner to Secs. 1, 2, 35 and 36 from which:

A Pine 30 in. dia. bears S45°E 24 lks. dist.

A Pine 36 in. dia. bears N70°E 40 lks. dist. A Pine 40 in. dia. bears N70°W 60 lks. dist.

A Pine 30 in. dia. bears S58°W 50 lks. dist.

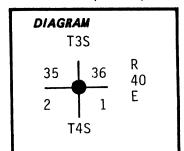

Description of corner evidence found:

No trace remains of the original corner post. We establish the True Corner Point from the remains of the original bearing trees as follows:

An orig. 30" Pine, now a 16" rotted stump center, no scribing on stump, with fragment of wood bearing old axe marks and a fragment of scribing, illegible, lying nearby, bears $$540^{\circ}$E 15.8 ft.$ (to face of stump).

An orig. 36" Pine, now a 30" rotted stump center, no marks remaining, bears N74°E 26.4 ft. (to face of stump).

An orig. 40" Pine, now a 36" rotted stump center, old axe marks remaining, bears N74°W 39.6 ft. (to face of stump).

And an orig. 30" Pine, now a 30" rotted stump, old axe marks remaining bears $S58^{\circ}W$ 33.0 ft. (to face of stump).

Description of monument and accessories I established to perpetuate the original location of this corner:

At the True Corner Point, we set a 2"x30" Galvanized Iron Pipe, 26"in the ground, with brass cap attached, <u>marked:</u>

T3S

From which we mark new BTs:

A 14" Douglas Fir, scribed "T4S R40E S1 BT" on a double blaze bears S70°E 47.0 ft.

A 16" Ponderosa Pine, scribed "T4S R40E S2 BT" on a double blaze bears S24°W 10.2 ft.

A 14" Ponderosa Pine, scribed "T3S R40E S35 BT" on a double blaze bears N33°W 21.5 ft.,

A 20" Ponderosa Pine, scribed "T3S R40E S36 BT" on a double blaze bears N26°E 13.2 ft.

Attached brass washer, marked "LS 1099" to lower blaze of new BTs. Drove steel fencepost alongside brass cap.

Compass Declination: 20° E.

Witnesses: Gary L

Gary L. Langlitz Glen Wagoner

Glen Wagoner David Allen PROFESSIONAL
LAND SURVEYOR

Jary J. Janglit

OREGON

GARY L. LANGLITZ

1099

Office of SURVEY OR	County of UNION	
State of OREGIN , I hereby certifor record on the IZ day of OCTOBER	fy that the within instrument was filed in	this office
HOWARD L. PERRY	by GARY LANGLITZ	SURVEYOR
(COUNTY OFFICIAL)	(DEPUTY)	Data Paraiyad
DC 7100 E7 /0/71\		Date Margina

Form R6-7100-57 (9/71)

R40E

S36

S1

T4S

PLS 1099 1981


S35

S2

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner originally established by Timothy W. Davenport under GLO Contract Number 102 dated July 20, 1863. Surveyor General record states: Set post corner to Secs 1,2,35 and 36, from which; A Pine 30 in. dia. bears S45°E, 24 lks dist. A Pine 36 in. dia. bears N70°E, 40 lks dist. A Pine 40 in. dia. bears N70°W, 60 lks dist. A Pine 30 in. dia. bears S58°W, 50 lks dist. Corner was remonumented in 1981. Monumentation record 550-84R states: No trace of the original corner post. We establish the true corner point from the remains of the original

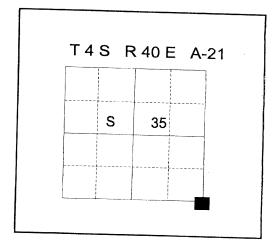

bearing trees as follows: an original 30" pine, now a 16" rotted stump center bears S40°E 15.8 ft. (to face of stump). An orig. 36" pine, now a 30" stump center bears N74°E 26.4 ft. (to face of stump). An orig. 40" pine, now a 36" stump center bears N74°E N74°W 39.6 ft. (to face of stump). An orig. 30" pine, now a 30" rotted stump bears S58°W 33.0 ft. (to face of stump). At the true corner point we set a 2"x30" galvanized iron pipe, 26" in the ground with brass cap attached marked (as shown below). From which new Bts: A 14" Douglas Fir scribed T4S R40E S1 BT bears S70°E, 47.0 ft. A 16" Ponderosa Pine scribed T4S R40E S2 BT bears S24°W, 10.2 ft. A 14" Ponderosa Pine scribed T3S R40E S35 BT bears N33°W, 21.5 ft. A 20" Ponderosa Pine scribed T3S R40E S36 BT bears N26°E, 13.2 ft.

Union County surveys 26-85 and 29-85 used the monumented position.

No record of subsequent monumentation found in Union County Survey Records. Description of corner Evidence Found:

Found brass cap monument marked as shown below. Found original Bts in same condition cited above. Found bearing trees taken in 1981 as follows: A 20" Douglas Fir bears S70°E, 47.0 ft. live and vigorous with scribes visible. A 18" Ponderosa Pine bears S24°W, 10.2 ft. live and vigorous with scribes visible. A 16" Ponderosa Pine bears N33°W, 21.5 ft. Live and vigorous with blaze evident. A 20" Ponderosa Pine N26°E, 13.2 ft. Has blown down. Scribed visible.

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

From the position of the found brass cap monument,

NEW BEARING TREE:

A 15 inch diameter Douglas Fir bears North 31° East, a distance of 71.05 feet, marked T3S R40E S36 BT $\,$

I hereby certify that the corner was rehabilitated on September 12, 2001. Witness: Norbert Volny

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON

RICK G. ROBINSON 2219

Renewal Date December 31, 2002

T 3 S

S 35 | S 36

S2 | S 1 | R 40E

T 4 S

OPLS 1099
1985

UNION COUNTY
SURVEYOR

Date Received 9/13/01

Date Filed 10/23/01

Filed B. 10/23/01

File Number 038-2001 R

I used a steel tape and magnetic compass in the establishment of the new accessory. I used 20° East declination. I set a brass washer marked OPLS 2219 at the top of the BT blaze. The distances to the new accessory is to the a 50d spike driven in the right side of the root crown.