
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner not previously established

DESCRIPTION OF CORNER EVIDENCE FOUND:

None Found

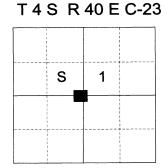

SEE SURVEY 039-2021

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At position by survey I set a 2 1/2" x 30" aluminum pipe, 26" in the ground, with 3" aluminum cap marked as shown below and surrounded by a 2' diam. collar of stone, from which:

NEW BEARING OBJECTS:

A 13" Ponderosa Pine bears North 78° East a dist. of 40.60 ft., marked C1/4 S1 BT.

A 6" Ponderosa Pine bears South 23° East a dist. of 72.95 ft., marked C1/4 S1 BT.


A 6" triple bole Ponderosa Pine bears South 38° West a dist. of 47.65 ft., marked C1/4 S1 BT on the most Northern bole.

A 4" Ponderosa Pine bears North 16° West a dist. of 30.00 ft., marked C1/4 S1 BT.

Set steel fence post approx. 1 ft. North

I hereby certify that the corner was monumented on July 15, 2021.

Witness: Kyle A. Tucker

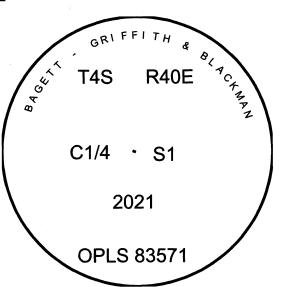

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
June 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2023

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 14° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.

