## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

## HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by John H. Stone under GLO contract Number 235, dated July 6, 1875. Surveyor General field notes state:

Set a stone 20x16x5 for corner to Secs 1+2, 11 and 12.

## DESCRIPTION OF CORNER EVIDENCE FOUND:

None

See Survey Number 022-2015

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At a position determined by survey, I set a  $2 \frac{1}{2}$ " x 30" aluminum pipe with a  $2 \frac{1}{2}$ " aluminum cap marked as shown below, 27" in the ground with a collar of stone 3 foot diameter. From which:

## **NEW BEARING OBJECTS:**

A 14" Ponderosa Pine bears North 39° East, a distance of 19.45 feet, marked T4S R40E S1 BT.

A 13" Ponderosa Pine bears South 40° East, a distance of 32.05 feet, marked T4S R40E S12 BT.

A 17" Ponderosa Pine bears South 52° West, a distance of 21.70 feet, marked T4S R40E S11 BT.

A 12" Ponderosa Pine bears North 65° West, a distance of 21.20 feet, marked T4S R40E S2 BT.

Corner falls in a North/South fenceline.

I set a steel fencepost approximately 1 foot North of corner monument.


I hereby certify that the corner was monumented on April 20, 2015.


Witness: Thomas J. Kopp

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
UP 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2017

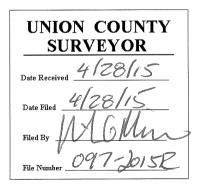

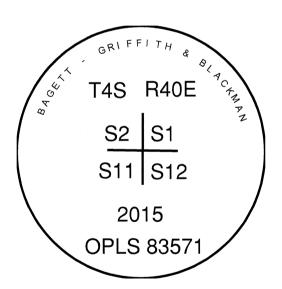

T4S R40 E E-21

1

S

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 16° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.