

**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**


**HISTORY OF ORIGINAL CORNER ESTABLISHED:**

Corner originally established by David Thompson under GLO contract number 103 dated September 3, 1863. Surveyor General field notes state:

Set post for 1/4 sec. corner in mound of earth with charred stake, pits, trench, as per instructions.

Corner monumented by W.B. Blakeley in Old Book Survey number 186, page 315. Union County Survey Record states:  
Set 1/4 corner rock 14x10x9

T 4 S R 40 E P-09

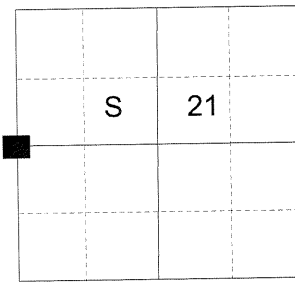

**DESCRIPTION OF CORNER EVIDENCE FOUND:**

Found a stone 15x11x9 Northwesterly approx. 100' with no discernible markings. It appears the stone was placed on the opposite side of the fence, possibly during field cultivation as the surveyed position falls in a tilled field. Due to the likelihood of disturbance, the stone position is not accepted.

See Survey 005-2020


**DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:**

At proportionate position I set a 5/8" x 30" iron pin with 2 1/2" aluminum cap, 8" below ground and marked as shown below, from which:

**NEW BEARING OBJECTS:**

- A 5/8" x 30" iron pin bears North 79°20' East a dist. of 86.24 ft., marked NE RP with BT tag on fence.
- A 5/8" x 30" iron pin bears North 1° West a dist. of 43.38 ft., marked N RP with BT tag on fence.
- A 5/8" x 30" iron pin bears South 1° West a dist. of 74.57 ft., marked SW RP.
- A 5/8" x 30" iron pin bears North 32° West a dist. of 64.44 ft., marked NW RP with BT tag on fence.

I hereby certify that the corner was monumented on March 3, 2020.  
Witness: Kyle A. Tucker

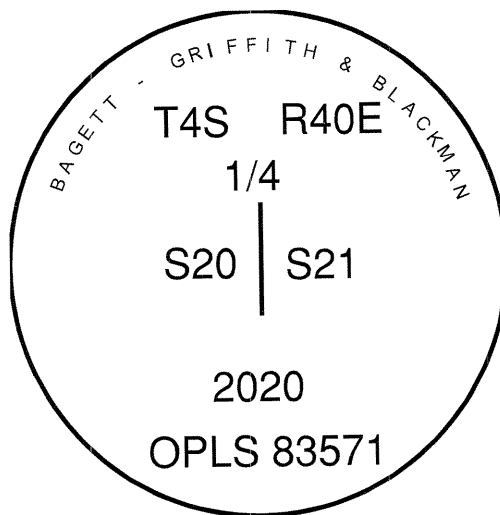

**UNION COUNTY SURVEYOR**

Date Received 3/7/20

Date Filed 3/7/20

Filed By M.G. Hsu

File Number 009-2020R

I used a Leica GS 18 in the establishment of the new accessories. Basis of Bearing is as per Survey 005-2020, the distances and bearings are to the center of the aluminum caps.