


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by Henry M. Thatcher under GLO contract number 320 dated April 1, 1879. Surveyor General record states:

Set stone 17x9x8 for 1/4 sec cor  
Raised stone mound at cor

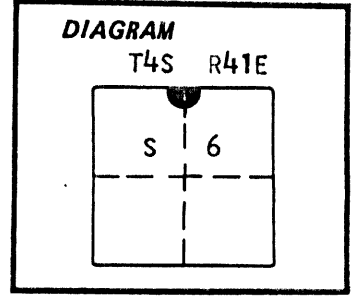

Corner was retraced by Alonzo Gesner under GLO contract number 683 dated June 7, 1898. Surveyor General record states;

"After diligent search, I could not find the 1/4 sec cor"

Mr. Gesner did not remonument this corner

Description of corner evidence found:

NONE

UNION COUNTY SURVEYOR	
Date Received	<u>10-20-86</u>
Date Filed	<u>10-27-86</u>
By	<u>G. Langhite Deputy</u>
File No.	<u>184-86 R</u>

See survey number 29-86 filed in the office of the Union County Surveyor  
Description of monument and accessories I established to perpetuate the

original location of this corner: At proportionate position, I set a 2 1/2"x30" aluminum pipe with aluminum cap marked as shown, 28 inches in the ground and raised a small mound of stone around the cap, from which:


An 8 inch Tamarack bears S 25° E, 40.09 feet marked 1/4 S6 BT.

A 17 inch Ponderosa Pine bears S 61° W, 22.57 feet, marked 1/4 S6 BT.

Set a steel fence post approximately 5 feet West with a 54-9 sign attached.

Corner set: 8/29/86

Witness: Greg Blackman, Rick Robinson

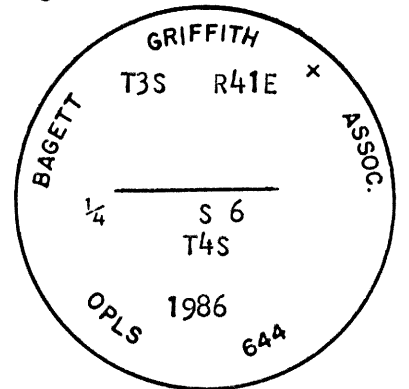

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

OREGON  
JULY 10, 1984  
DUANE I. GRIFFITH  
644

Brass washer marked OPLS 644 nailed to BT blaze. Used steel tape and magnetic compass with 20° East declination. Distances to the BTs are to a 50d spike set in right side of tree when facing tree, unless otherwise stated.

Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by .....  
(COUNTY OFFICIAL) (DEPUTY)