
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: Corner originally established by Henry M. Thatcher under GLO contract number 320 dated April 1, 1879. Surveyor General record states:

Set stone 15x9x7 for 4 sec cor raised stone mound at cor

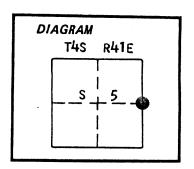

No record of subsequent remonumentation found in county records. Description of corner evidence found:

Stone 16"x9"x7" with faint chisle marks in a mound of stone. Corner has been undisturbed. Creek call to the south very harmonious.

See map of survey number 29-96 filed in the office of the Union County Surveyor Description of monument and accessories I established to perpetuate the original location of this corner: At the stone position , I set a $2^{1}2^{1}\times30^{11}$ aluminum pipe with aluminum cap marked as shown 28 inches in the ground and riased a small mound of stone to top of cap. From which:

A 10 inch Douglas Fir bears S 80° E, 21.70 feet, marked $\frac{1}{4}$ S 4 BT.

A 9 inch Douglas Fir bears S 17° W, 16.58 feet, marked $\frac{1}{4}$ S5 BT.

Set a steel fence post approximately 5 feet North with a 54-9 and 54-2 sign attached. GRIFFITH

Set a steel fence post approximately 5 feet South with a 54-2 sign attached.

Buried stone south. Corner set 8/21/86 Witness: Greg Blackman, Greg Blackman Jr.

REGISTERED **PROFESSIONAL** AND SURVEYOR V

DUANE I. GRIFFITH

644

Brass washer marked OPLS 644 nailed to BT blaze. Used steel tape and magnetic compass with 20° East declination. Distances to the BTs are to a 50d spike set in right side of tree when facing tree, unless otherwise stated.

	County of I hereby certify that the within	
for record on the da	UNION COUNTY. 19	
(COUNTY OFFICIAL) SURVEYOR		(DEPUTY)
Form R6-7100-57 (9/71)	Date Received 10-20-86	文U.S. GOVERNMENT PRINTING OFFICE - 1983-793-276

亚-23

T4s

S 5

R41E

s 4

6⁴

1986