
CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Corner not established in original survey

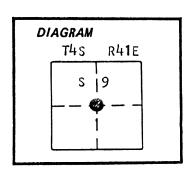

Description of corner evidence found:

NONE

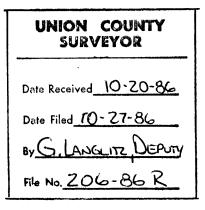

See map of survey number 29-86 filed in the office of the Union County Surveyor Description of monument and accessories lestablished to perpetuate the

original location of this corner: At position determined by survey, I set a 2½ × 30 aluminum pipe with aluminum cap marked as shown, 28 inches in the ground and raised a mound of stone with a 3 foot base to top of cap, from which:

An 8 inch White Fir bears N 76° W, 2.51 feet, marked C4 S9 BT.

A 24 inch Tamarack bears N 36° W, 26.88 feet, marked C4 S 9 BT.

Set a steel fence post approximately 5 feet South with a 54-2 and 54-9 sign attached.

Corner set: 8/28/86
Witness: Greg Blackman, Rick Robinson


REGISTERED

PROFESSIONAL

AND SURVEYOR

OREGON ULY 10: 1964

DUANE I. GRIFFITH

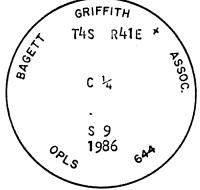

Brass washer marked OPLS 644 nailed to BT blaze. Used steel tape and magnetic compass with 20° East declination. Distances to the BTs are to a 50d spike set in right side of tree when facing tree, unless otherwise stated.

Office of	. County of
State of , I hereby certify that the within instrument was filed in this office	
for record on the day of	
by	
	(DEPLITY)

Form R6-7100-57 (9/71)

\$U.S. GOVERNMENT PRINTING OFFICE - 1983-793-276

1.13