
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by J.L. Curtis on survey dated March 26, 1894 and recorded as survey number 178, in the old book of Union County Surveys. His notes state:


Set corner for SE corner of SW4 of NW4 Sec 18

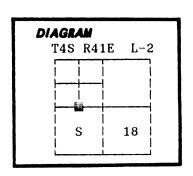

No record of subsequent monumentation found in Union County survey records.

Description of corner evidence found:

No evidence of the Curtis corner was found. See Union County survey number 29-88

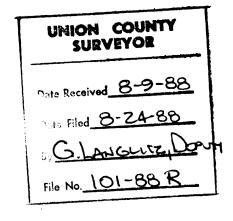

Description of monument and accessories I established to perpetuate the

original location of this corner: At the position determined by survey, I set a $2\frac{1}{2}$ " x 30" aluminum pipe with aluminum cap marked as shown, 12 inches in the ground, in concrete, from which;


New Bearing Trees; A 13 inch diameter Ponderosa Pine bears $$560^\circW , 27.39 feet marked CW1/16 S18 BT A 10 inch diameter Douglas Fir bears $$N18^\circW , 29.90 feet marked CW1/16 S18 BT

Raised mound of stone around monument, 4 ft. base to top of cap.

Set a steel fencepost approximately 5 feet West with 54-9 sign attached.

I hereby certify that the above corner point was perpetuated as hereon described on July 27, 1988.

Witness: Jeff Petersen

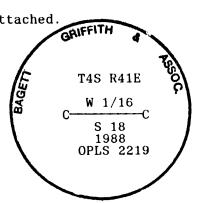

REGISTERED
PPOFESSIONAL
LAND SURVEYOR

OREGON JULY 17, 1996 RICK G. ROBINSON 2219

Nol

I used a steel tape and magnetic compass in the establishment of new accessories. I used 18° magnetic declination. The distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 2219 to the BT blaze.

Office of	County of
State of	I hereby certify that the within instrument was filed in this office
for record on the day of	, 19
	by
(COUNTY OFFICIAL	

Form R6-7100-57 (9/71)

GPO---798-276