
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


Corner not previously established

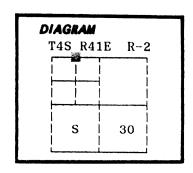

No record of subsequent monumentation found in Union County survey records.

Description of corner evidence found:

Corner not previously established See Union County survey number 29-88

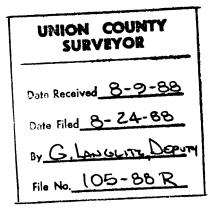

Description of monument and accessories I established to perpetuate the

original location of this corner: At the position determined by survey, I set a $2\frac{1}{2}$ " x 30" aluminum pipe with aluminum cap marked as shown, 12 inches in the ground, from which;


New Bearing Trees; A 16 inch diameter Ponderosa Pine bears S86°E, 35.41 feet marked W1/16 S30 BT A 25 inch diameter Ponderosa Pine bears N52°W, 39.20 feet marked W1/16 S19 BT


Raised a mound of stone around monument, 4 ft. base to top of cap.

Set a steel fencepost approximately 5 feet North with 54-9 sign attached.

I hereby certify that the above corner point was perpetuated as hereon described on July 27, 1988.

Witness: Jeff Petersen

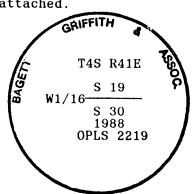



OREGON JULY 17, 1066 RICK G. ROBINSON 2219 I used a steel tape and magnetic compass in the establishment of new accessories. I used 18° magnetic declination. The distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 2219 to the BT blaze.

Office of	County of
	ify that the within instrument was filed in this office
for record on the day of	
	. by
(COUNTY OFFICIAL)	(DEPUTY)

Form R6-7100-57 (9/71)

GPO---798-276