


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:
Corner not previously established.

T 4 S R 41 E X-06

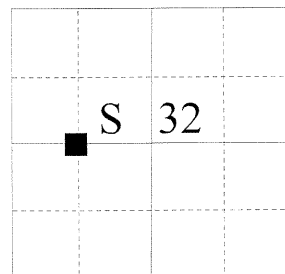

DESCRIPTION OF CORNER EVIDENCE FOUND:
None

See Survey Number 031-2012

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At position determined by survey, I set a 5/8"x30" iron pin with 2 1/2" aluminum cap, 28 inches in the ground, from which:

A 10 inch Douglas Fir bears North 33° East, a distance of 22.30 feet,
marked CW 1/16 S32 BT.

A 6 inch Western Larch bears South 45° West, a distance of 40.45 feet,
marked CW 1/16 S32 BT.

Corner falls on a thinly timbered South slope approx. 450 feet South of road. I set a steel fencepost 1 foot South of the corner monument.

I hereby certify that the corner was monumented on September 25, 2012.

Witness: Rick Robinson

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**



OREGON
June 2, 2010
JEFFERY S. HSU
83571

Renewal Date: June 30, 2013

BAGETT - GRIFFITH & BLACKMAN

T 4 S R 41 E
W 1/16

C ————— C

S 32

2012

PLS 83571

**UNION COUNTY
SURVEYOR**

Date Received 9/28/12

Date Filed 9/28/12

Filed By R. ROBINSON DEATY

File Number 038-2012R

I used a steel tape and magnetic compass in the establishment of the accessories. I used 16° East declination, the distance to the Northeast bearing tree is to a 60d spike driven into the root crown at the right side of the tree. The distance to the Southwest tree is to a 60d spike driven into the root crown at the left side of the tree. I place a brass washer marked OPLS 83571 in the lower blaze of the accessories.