
# CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment: Corner originally established by Henry M. Thatcher under GLO Contract number 320 dated April 1, 1879. Surveyor General record states:

Set stone 39''x19''x5'' in a mound of stone for  $\frac{1}{4}$  section corner.

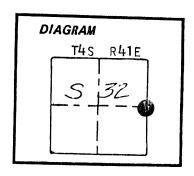

No record of subsequent remonumentation found in county records. Description of corner evidence found:

Found stone 38''x18''x5'' broken into four pieces in a small mound of stone. Stone marked  $\frac{1}{4}S$ .

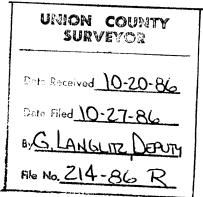

Description of monument and accessories I established to perpetuate the

original location of this corner: At stone position, I set a 2½'x30" aluminum pipe with aluminum cap marked as shown 20 inches in the ground and raised a mound of stone with a 3 foot base to top of cap. Buried stone east of cap. From which:


An 8 inch Ponderosa Pine bears N  $32^{\circ}$  E, 33.08 feet, marked  $\frac{1}{4}$  S 33 BT.

A 9 inch Ponderosa Pine bears N  $59^{\circ}$  W, 53.87 feet, marked  $\frac{1}{4}$  S 32 BT.

Set a steel fence post approximately 5 feet East with a 54-9 sign attached.

Corner set 7/22/86
Witness: Rick Robinson

Note: When burying the stone, I actually buried the marked broken pieces.

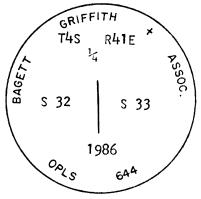

DREGON
JULY 19, 1984

DUANE I. GRIFFITH

REGISTERED PROFESSIONAL

Brass washer marked OPLS 644 nailed to BT. Used steel tape and magnetic compass with 20° East declination. Distances to the BTs are to a 50d spike set in right side of tree when facing tree, unless otherwise stated.

Office of	County of
for record on the day of	y that the within instrument was filed in this office , 19
(COUNTY OFFICIAL)	<i>by</i> (DEPUTY)

Form R6-7100-57 (9/71)

## <u>ATIFIED RECORD OF LAND CORNER MONUMENTATION</u>

#### HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner originally established by Henry M. Thatcher under GLO contract number 320, dated April 1, 1879. Surveyor General record states:


Set stone 39x19x5 in a mound of stone for 1/4 sec. cor.

In 1986, Duane Griffith find stone brings monument to county standard. Union County Monumentation record states:

At stone position, I set a 2  $\frac{1}{2}$ " x 30" aluminum pipe with aluminum cap marked as shown, 20 inches in the ground and raised a mound of stone with a 3 foot base to top of cap, from which:

An 8 inch diameter Ponderosa Pine bears  $N32^{\circ}E$ , 33.08 feet marked 1/4 S33 BT.

A 9 inch diameter Ponderosa Pine bears N59°W, 53.87 feet marked 1/4 S32 BT.

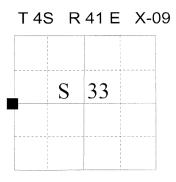

#### DESCRIPTION OF CORNER EVIDENCE FOUND:

Found 2  $\frac{1}{2}$ " Aluminum pipe with 2  $\frac{1}{2}$ " cap, marked as shown below, 5 inches above ground in a mound of stone 3 feet diameter, from which:

A 15 inch Ponderosa Pine bears North  $30^{\circ}$  East, a distance of 33.00 feet, alive and vigorous with a healed blaze.

A 14 inch Ponderosa Pine bears North  $60^{\circ}$  West, a distance of 53.90 feet, alive and vigorous with a healed blaze.

#### DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

#### TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

From the corner monument position,

### NEW BEARING TREES

A 12 inch Ponderosa Pine bears South  $4^{\circ}$  East, a distance of 27.25 feet, marked 1/4 S33 BT. An 8 inch Ponderosa Pine bears South  $73^{\circ}$  West, a distance of 103.80 feet, marked 1/4 S32 BT.

I hereby certify that the corner was perpetuated on September 21, 2012.

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON
June 2, 2010
JEFFERY S. HSU
83571

Renewal Date: June 30, 2013

UNION COUNTY
SURVEYOR

Date Received 978/12

Date Filed 978/12

File Number 046-2012 R

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 16° East declination, the distances are to a 60d spike driven into the root crown at the right side of the bearing trees. I place a brass washer marked OPLS 83571 in the lower blaze of the new accessories.