

74-69A

66


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T-17

History of original corner establishment:

Original survey by General Land Office contract survey 1882

The original notes read; Set a post from which;
A pine 26" in diam bears S13°E 14 lks dist marked $\frac{1}{4}$ SBT.
A pine 22" in diam bears S28°W 27 lks dist marked $\frac{1}{4}$ SBT;

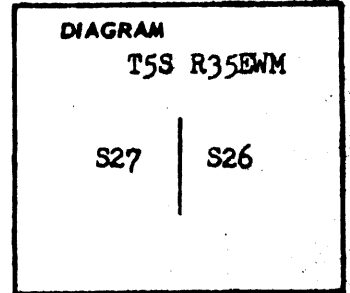

Description of corner evidence found:


There is an obvious error in the original notes at this corner.
Found A pine 16" in diam in section 26 with scribe.
In section 27 found a down pine log with scribe . The total distance
between the two bearing trees is more than shown in original notes. Given bearings
from bearing trees does not fit either scribe to come to a intersection.
Set the corner to fit scribe marked on bearing trees.



Description of monument and accessories I established to perpetuate the original location of this corner

At the corner set a 2" galvanised pipe 30" long with a bronze cap on top and 8" plate welded to bottom. The pipe set to a depth of 24" and backfilled with stone and tamped soil.

I stamped the disk

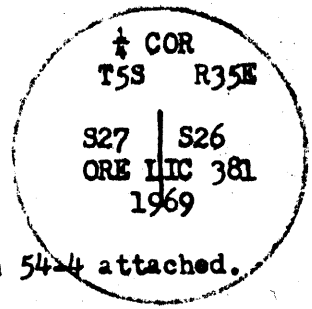

The original bearing tree from the corner is;
A pine 16" in diam bears S88°E 20 ft. dist marked $\frac{1}{4}$ SBT
I set a new bearing tree; A pine 5" in diam bears S84°W 20.1
ft. distance marked $\frac{1}{4}$ SBT. Distance measured to center of trees
and marked with scribe. I set a steel fence post with USFS sign 5424 attached.
USFS bearing tree signs were placed on the bearing trees
shoulder high facing the corner.

Office of..... Co. Surveyor..... County of..... Union.....
State of..... Oregon....., I hereby certify that the within instrument was filed in this office
for record on the ...13. day of .. Sept....., 1969, at .. 9 .. o'clock .. m., (signed)
..... Co. surveyor..... by *James G. Voelz*.....
(COUNTY OFFICIAL) (SURVEYOR)

UNION COUNTY SURVEYOR

Date Received _____
Date Filed _____
By _____
File No. 621-84R