


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

None.

Index File No. W-25

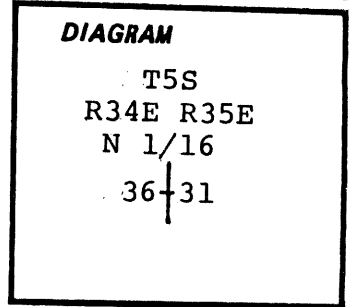

Description of corner evidence found:

No corner monuments or other official accessories found.

Description of monument and accessories I established to perpetuate the original location of this corner:

Cap is stamped:

Set 2.5" aluminum cap on 2 3/8"x30" aluminum pipe rising 6" above ground. Set steel fence post 3.0" ft. So. of corner,

T5S
N1/16
R34E R35E
S36 S31
RLS 1844
1984

New BT's:

An 8" L. Pine bears S44.5°W, 57.0 ft., blazed & scribed: N 1/16 S36 BT.

A 7" L. Pine bears S19°E, 12.7 ft., blazed and scribed: N 1/16 S31 BT.

Brass LS 1844 disc in lower end of blaze. Painted blazes and attached signs as per Standard Specifications for Cadastral Surveys, USFS Region 6, March 1982.

Compass Declination: 19 3/4°E

Witness: Duane Scott

Corner is found at base of west slope, 170 ft. west of Little Fly Creek, 400 ft. north of gate on private road.

I hereby certify the above described corner monument and/or accessories was established as described on July 18, 1984.

REGISTERED PROFESSIONAL LAND SURVEYOR
<i>David E. Scott</i>
OREGON JULY 13, 1979 DAVID E. SCOTT 1844

Office of..... County of.....  
State of..... I hereby certify that the within instrument was filed in this office  
for record on the..... day of....., 19.....

(COUNTY OFFICIAL)

(DEPUTY)

<b>UNION COUNTY SURVEYOR</b>
Date Received <u>10-17-84</u>
Date Filed <u>10-24-84</u>
By <u>G. LANGRITZ, DEPUTY</u>
File No. <u>981-84 R</u>

**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

W-25


**History of original corner establishment:**

Corner originally established in 1984 by David E. Scott, RLS 1844, under U.S. Forest Service contract. Excerpts from Scott's notes state:

Set a 2.5" aluminum cap on 2 3/8" x 30" aluminum pipe rising 6" above ground. Set steel fence post 3.0 ft. So. of corner. Cap is marked as shown in corner diagram.

New BT's:

An 8" L. Pine bears S44.5°W, 57.0 ft., blazed and scribed: N 1/16 S36 BT.  
A 7" L. Pine bears S19°E, 12.7 ft., blazed and scribed: N 1/16 S31 BT.

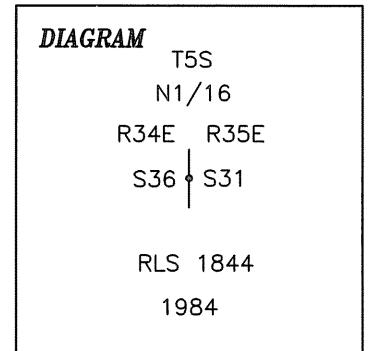

**Description of corner evidence found:**

Found a 2 1/2" diameter aluminum cap on an aluminum pipe, 6" above the ground. A steel fence post with 54-2 and 54-9 signs is 1.8' south of monument.

From which:

A Lodgepole Pine snag, 6' high and 12" in diameter bears S19°E, 12.7' with burnt face and faint scribing.  
A Lodgepole Pine snag, 13" in diameter bears S38°W (Record S44.5°W), 57.3' (Record 57.0') scribed N 1/16 S36 BT, with a brass washer between the B and T.

**Description of monument and accessories I established to perpetuate the original location of this corner:**

New bearing trees:

A Lodgepole Pine 9" in diameter bears S82°E, 136.8' scribed N 1/16 S31 BT.  
A Lodgepole Pine 7" in diameter bears S48°W, 70.2' scribed X BT.

The new bearing trees have a 30d spike in the right side center and a brass disc stamped PLS 2672 placed between the B and T on the lower face, All bearing trees have 54-3 and 54-9 signs, a 6" red painted band, and bearing tree face painted red.

The corner monument is 2' south of an east-west fence. Area burned by the Fly Fire in 2005.

Geodetic Coordinates (NAD83):

N 45°05'29.20"

W 118°29'09.86"

Geodetic coordinates were obtained from a Trimble Geo-Explorer mapping grade GPS receiver and have been differentially corrected.

Date: June 27, 2007  
Declination: 16°E

**UNION COUNTY SURVEYOR**

---

Date Received 8/16/07

Date Filed 9/17/07

By R. ROBINSON, DEPUTY

File No. 015-2007R

**REGISTERED PROFESSIONAL LAND SURVEYOR**

*Kenneth A. Lind*

OREGON  
JULY 19, 1994  
KENNETH A. LIND  
2672

Renews: 12-31-08