
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

In 1882, under GLO Contract No. 452 H. Gradon set a post 4 ft. long, 4 ins. square 24 ins. in ground for corner to Secs. 17,18, 19 & 20 marked: T5S S17 on N.E., R36E S20 on S.E., S19 on S.W. and S18 on N.W. faces with 3 notches on S and 5 notches on E. edges, from which: A Pine 10" dia. bears N70 E 32 lks. dist. marked T5S R36E S17 BT. A Pine 8" dia. bears S57 E 50 lks. dist marked T5S R36E S20 BT. A Pine 10" dia. bears S55 W 25 lks dist marked T5S R36E S19 BT. A Pine 8" dia. bears N22 W 90 lks. dist marked T5S R36E S18 BT.

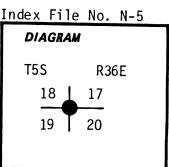

Description of corner evidence found:

Found piece of S.W. BT with faint scribing "S" visible. Located the stump hole with remains of burnt roots. Established a point N55 $^{\circ}$ E, 16.5 ft. for corner location. Found remains of stump holes for NE & NW original BT's. Found traces of charcoal at established corner location.

Could find no evidence of the original corner post.

Description of monument and accessories I established to perpetuate the original location of this corner:

At established point for corner location set 2½"x30" galvanized pipe T5S R36E with brass cap stamped: Set pipe 24" in ground with mound of dirt to cap. S18 S17

Bearing trees: A Lodgepole Pine 8" dia. bears N61⁰E 68.35 ft., S 19

S20 scribed T5S R36E S17 BT.
A Tamarack 20" dia. bears \$43½0E, 164.45 ft. scribed T5S R36E S20 BT. PLS 1099 1982

A Tamarack 15" dia. bears $S72\frac{1}{2}^{0}W$, 170.0 ft. scribed T5S R36E S19 BT. A Lodgepole Pine 8" dia. bears $N64\frac{1}{4}^{0}W$, 39.4 ft. scribed T5S R36E S18 BT.

Painted trees and attached signs as per $\underline{Standard}$ $\underline{Specifications}$ \underline{For} $\underline{Cadastral}$ $\underline{Surveys}$ U.S.F.S. Region 6 October 1979. Attached 54-4 sign to metal post 6 ft. South of corner.

Corner falls in pole thicket being cut for poles, approx. 30 ft. North of old E-W skid road and 500 ft. North of location tag on dirt road.

RED ONAL VEYOR Q OREGON L. LANGLITZ

Compass Declination: 190E

I hereby certify the above described corner monument and/or accessories was established on August 11, 1982.

Witnesses: R. Orton

G. Wagoner R. Scott

Surveyor Office of State of. Oregon ... I hereby certify that the within instrument was filed in this office UNION COUNTY for record on the A. day of OCTOBER 19.82
Howard L. Perry
(COUNTY OFFICIAL)

Form R6-7100-57 (9/71)

SURVEYOR

Date Received
☆ GPO-798-276

File No. 638 - 84 R