CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: Corner established in 1882 by William R. Gradon;


Surveyor General Notes State;

Set a basalt stone 12"x10"x6", 8" in the ground for section corner, marked $\frac{1}{4}$ on the West face, from which B.T.'s

A tamarack 30" in diameter bears S 88 E 188 lks. dist. marked $\frac{1}{4}$ S B.T.

A tamarack 26" in diameter bears N 24 W 63 Lks. dist. marked 1 S B.T.

No subsequent surveys found.

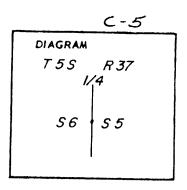

Description of corner evidence found:

Found B.T.'s

A tamarack 30" in diameter , blaze visible

A tamarack 24" in diemeter, scribes visible

Stone not found.

Description of monument and accessories I established to perpetuate the

original location of this corner Set l"x36" iron pipe with brass cap, 30" in the ground, raised mound of stone at the intersection of the distance ties to the bearing tree; from which


Orig. Bearing trees
A 30" Tamarack bears S 81 E 124.1 ft. blaze visible

A 24" Tamarack bears N 23 W 41.6 ft. marked $\frac{1}{4}$ S B.T. New B.T.'S

A Tamarack 12" in diameter bears S 25 E 128.8 feet marked $\frac{1}{4}$ S 5 B.T.

A 34" Tamarack bears S 41 W 117. ft. dist. marked $\frac{1}{4}$ S 6 B.T.

All measurements taken to the center of the tree. I used a steel tape and a magnetic compass, set declination was 20 degrees East.

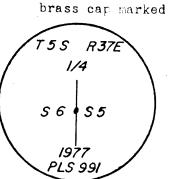

Office of County o	REGISTERED PROFESSIONAL LAND SURVEYOR	
State of, I hereby certify that the w for record on the day of	thin instructed "COUNTY"	Lugoy 1. Blackm
(COUNTY OFFICIAL)	(DEPUTY) Orre Received	OREGON JULY 13, 1975 GREGORY T. BLACKMAN 991
	Date Filed	
	Ву	

File No. 678-84R

Form R6-7100-57 (9/71)

History of original corner establishment:

William R. Gradon conducted the survey of Township 5 South, Range 37 East, W.M., under GLO contract No. 445, dated June 1, 1882.

Gradon set a basalt stone 12" x 10" x 6", 8" in the ground, mkd. 1/4 on West face. From which:

A tamarack 30" dia. bears S 88 E at 188 lks. A tamarack 26" dia. bears N 24 W at 63 lks.

DIAGRAM
T5S R37E
14
S6 | S 5
1977
PLS 991

In October, 1977, Greg T_{\bullet} Blackman re-monumented the corner point and scribed two new bearing trees.

Description of corner evidence found:

Found $2\frac{1}{2}$ " dia. brass cap on a $1\frac{1}{4}$ " dia. iron pipe, well set into the ground. Brass cap mkd. as shown in the corner diagram.

BT's-

A 21" dia. dead and standing Western Larch bears N 24 W at 41.6 ft. mkd. 1/4 S / BT.

A 31" dia. dead and standing Western Larch bears S 85 E at 124.0 ft. mkd. with healed blaze.

A 27" dia. live Western Larch bears S 41 W at 117.0 ft. mkd.

1/4 S6 BT.

A 13" dia. live Western Larch bears S 25 E at 128.8 ft. mkd. with healed blaze.

Description of monument and accessories I established to perpetuate the original location of this corner:

Attached U.S.F.S. 54-9 and 54-3 signs to the bearing trees as needed, And painted the blaze and a 6" band around the bearing trees red. Set a steel fence post 4' West and attached a U.S.F.S. 54-9 sign to it. Used $18\frac{1}{2}$ ° declination on a staff compass for readings to the bearing trees and used a steel tape to measure to the center of the bearing trees at the base.

This corner was maintained to U.S.F.S. specifications on May 19, 1987, witnessed by Tom Fisk and Larry McBroom.

1	union county surveyor
	Date Received 5-1-89
	Date Filed 5-15-89
	By G. LANGLITZ, DONTY
	File No. 54-89 R

Office of County Surveyor	County of Union		
State of Oregon			
for record on the day of	, 19		
by			
(COUNTY OFFICIAL)			

Form R6-7100-57 (9/71)

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON
SEPTEMBER 23, 1977
JAMES D. HANLEY

☆ GPO---788-276