


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

E-6

History of original corner establishment:

None, corner established this survey.

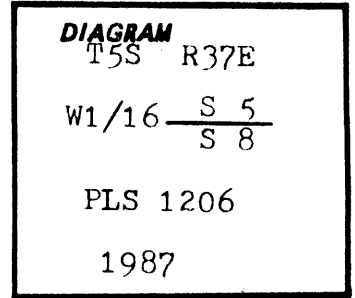

Description of corner evidence found:

None.

Description of monument and accessories I established to perpetuate the original location of this corner:

At the corner point: set a 2½" x 30" aluminum pipe 24" into the ground, with 36" dia. stone mound around it. 2½" aluminum cap marked as shown in the corner diagram.

From the corner point: (Bearing Trees)

- A 9" dia. Western Larch bears N 1° W at 48.7 ft. dist., mkd. W1/16 S 5 BT.
- A 9" dia. White Fir bears S 46° W at 43.8 ft. dist., mkd. W1/16 S 8 BT.

Attached U.S.F.S. 54-9 and 54-3 signs to the bearing trees, and painted the face of the blaze and a 6" band around the bearing trees red. Attached a 3/4" dia. I.D. washer, mkd. PLS 1206, between the B and T scribes. Set a steel fence post 4' dist. with U.S.F.S. 54-9 and 54-2 signs attached. Used 18½° declination on a staff compass for readings to the bearing trees, and used a steel tape to measure to a nail set in the side of the trees at the base.

This corner was monumented to U.S.F.S. specifications on June 19, 1987, witnessed by Tom Fisk, Larry McBroom and Tim Rouse.

UNION COUNTY SURVEYOR	
Date Received <u>5-1-89</u>	
Date Filed <u>5-15-89</u>	
By <u>G. LANGLITZ, DEPUTY</u>	
File No. <u>63-89R</u>	

Office of County Surveyor County of Union
State of Oregon I hereby certify that the within instrument was filed in this office
for record on the day of , 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

REGISTERED PROFESSIONAL LAND SURVEYOR

James D. Hanley
OREGON
SEPTEMBER 23 1977
JAMES D. HANLEY
1206