


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

William R. Gradon conducted the survey of Township 5 South, Range 37 East, W.M., under contract No. 445 dated June 1, 1882.

Gradon set a post for the corner point, from which:
A black pine 14" dia. bears N 40 E at 12 lks.
A black pine 12" dia. bears S 10 W at 8 lks.

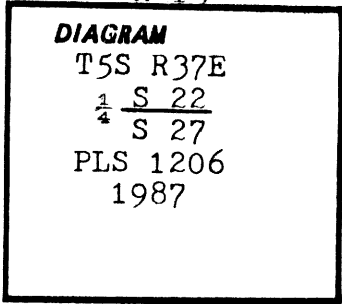

Description of corner evidence found:

None.

Description of monument and accessories I established to perpetuate the original location of this corner:

After a thorough search of the area revealed no corner evidence, established the proportioned corner point.

Set a 2½" x 30" aluminum pipe with a 2½" aluminum cap, 24" into the ground, with a 36" dia. stone mound. Cap is marked as shown in the corner diagram.

From the corner point: (New BT's)

- A 18" dia. Spruce bears S. 87° E. at 39.4 ft. dist., mkd. ¼ S 27 BT.
- A 9" dia. L.P. Pine bears N. 64° W. at 31.6 ft. dist., mkd. ¼ S 22 BT.

Set a steel fence post 4' East from the monument and attached USFS 54-2 and 54-9 signs. Painted the face of the blaze and a 6" band around the bearing trees red. Attached I.D. washer and USFS 54-9 and 54-3 signs to the bearing trees. Used 18½° declination on a staff compass for readings to the bearing trees. Used a steel tape to measure to a nail set in the side of the trees. The ¾" dia. brass I.D. washer mkd. PLS 1206 was nailed between the B and T scribes.

This corner was monumented to USFS specifications on October 22, 1987, witnessed by Tom Fisk, Larry McBroom and Andy Marlette.

**UNION COUNTY
SURVEYOR**

Date Received 5-1-89
Date Filed 5-15-89
By G. LANGRISH, DEPUTY
File No. 77-89 R

Office of County Surveyor County of Union
State of Oregon I hereby certify that the within instrument was filed in this office
for record on the day of , 19

..... by
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

James D. Hanley
**OREGON
SEPTEMBER 23 1977
JAMES D. HANLEY
1206**