


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T-14

History of original corner establishment:

None, corner established this survey.

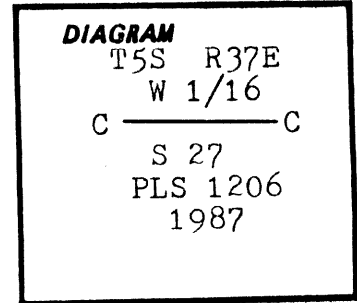

Description of corner evidence found:

None.

Description of monument and accessories established to perpetuate the original location of this corner:

At the corner point: set 2½" x 30" aluminum pipe 24" into the ground with no stone mound. 2½" dia. aluminum cap mkd. as shown in the corner diagram.

From the corner point: (Bearing trees)

A 11" dia. Spruce bears N 40 W at 16.2 ft. dist. mkd. CW1/16 S 27 BT

A 9" dia. Spruce bears S 58 E at 13.7 ft. dist. mkd. CW1/16 S 27 BT

Attached U.S.F.S. 54-9 and 54-3 signs to the bearing trees, and painted the face of the blaze and a 6" band around the bearing trees red. Attached a 3/4" dia. I.D. washer, mkd. PLS 1206, between the B and T scribes. Set a steel fence post 4' South with U.S.F.S. 54-9 sign attached. Used 18½° declination on a staff compass for readings to the bearing trees, and used a steel tape to measure to a nail set in the side of the trees at the base.

This corner was monumented to U.S.F.S. specifications on October 26, 1987, witnessed by Tom Fisk, Larry McBroom and Andy Marlette.

UNION COUNTY SURVEYOR	
Date Received	<u>5-1-89</u>
Date Filed	<u>5-15-89</u>
By	<u>G. LANGLITZ, DEPUTY</u>
File No.	<u>84-89R</u>

Office of...County...Surveyor..... County of...Union.....
State of...Oregon..... I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

REGISTERED
PROFESSIONAL
LAND SURVEYOR

James D. Hanley
OREGON
SEPTEMBER 23, 1977
JAMES D. HANLEY
1206