


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T-16

History of original corner establishment:

None, corner established this survey.

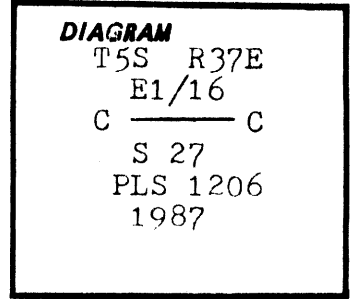

Description of corner evidence found:

None.

Description of monument and accessories I established to perpetuate the original location of this corner:

At the corner point; set 2½" x 30" aluminum pipe 18" into the ground, with 36" dia. stone mound around it. 2½" aluminum cap mkd. as shown in the corner diagram.

From the corner point: (Bearing trees)

BT. A 8" dia. Lodgepole Pine bears N 17 E at 35.0 ft. dist. mkd. CE1/16 S27

BT. A 9" dia. Lodgepole Pine bears N 61 W at 28.2 ft. dist. mkd. CE1/16 S27

Attached U.S.F.S. 54-9 and 54-3 signs to the bearing trees, and painted the face of the blaze and a 6" band around the bearing trees red. Attached a 3/4" dia. brass I.D. washer, mkd. PLS 1206, between the B and T scribes. Set one steel fence post 4' North with U.S.F.S. 54-2 sign attached. Set another steel fence post 4' West with U.S.F.S. 54-9 and 54-2 signs attached. Used 18½° declination on a staff compass for readings to the bearing trees, and used a steel tape to measure to a nail set in the side of the tree at the base.

This corner was monumented to U.S.F.S. specifications on October 27, 1987, witnessed by Tom Fisk, Larry McBroom and Andy Marlette.

<b>UNION COUNTY SURVEYOR</b>	
Date Received	<u>5-1-89</u>
Date Filed	<u>5-15-89</u>
By	<u>G. LANGLITZ, DEPUTY</u>
File No.	<u>86-89R</u>

Office of... County Surveyor..... County of... Union  
State of... Oregon....., I hereby certify that the within instrument was filed in this office  
for record on the..... day of....., 19.....

(COUNTY OFFICIAL)

(DEPUTY)

Form R6-7100-57 (9/71)

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*James D. Hanley*  
OREGON  
SEPTEMBER 21 1977  
JAMES D. HANLEY  
1206