
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner set by William R. Gradon, under GLO Contract No. 445, approved December 5, 1882.

Record States: Set a post 3 ft long 3 ins square, 24 ins in the ground for $\frac{1}{4}$ sec. cor. marked 1/4 S on N face, from which:

A fir 6 ins diam bears N44°W 12 lks dist marked 1/4 S BT A fir 6 ins diam bears S2°E 15 lks dist marked 1/4 S BT

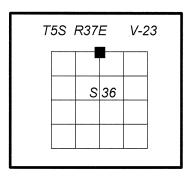

Description of corner evidence found:

Thorough search of area finds no evidence of original corner. Search area has been logged extensively. Corner is determined lost and reestablished by proportionate measurement.

Description of monument and accessories I established to perpetuate original location of this corner:

At the position determined by survey, I set a standard USFS 2% ins. diam. by 30 ins. long alum. post, 26 ins. in the ground with 31/4 ins. diam. alum cap, with rock collar and clear DEEP-1 magnet at base, marked as shown: From which:

A tamarack, 11 ins. diam., bears N. 51½° E., 12.5 ft. dist., mkd.1/4 S25 BT.

A lodgepole pine, 6 ins. diam., bears S. 63° E., 37.9 ft. dist., mkd. X BT on double blaze. A lodgepole pine, 6 ins. diam., bears S. 52° W., 21.3 ft. dist., mkd. XBT.

An Englemann spruce, 6 ins. diam., bears N. 39° W., 40.6 ft. dist., mkd. XBT.

Set guard posts ±5 ft. Wly with Property Boundary (54-2) and Land Survey Monument (54-9) signs and ±5 ft. E'ly with Property Boundary (54-2) sign.

All new bearing trees are marked on a single blaze unless noted otherwise and have a nail with a brass washer stamped "LS 2648" right side center for distance measurements.

Painted 6 ins. red bands and added Bearing Tree (54-3) and Land Survey Monument (54-9) signs as needed to all bearing trees

Auto C/A geographic position: Lat. 45°05'35.5" N Long. 118°07'36.0" W

I hereby certify that the corner was monumented and accessories taken as described, using a Warren Knight staff compass, set with 15° East declination, and steel tape on August 21, 2014.

Witnesses: Brenda Johnson and Justin Seal



REGISTERED PROFESSIONAL LAND SURVEYOR

Jeceased

OREGON JANUARY 18, 1994 RON C. WALTER 2648

Renewal Date: June 30, 2016

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON July 22, 1977 WILLIAM R. WELLS

> 1106 Renewal Date: June 30, 2016

UNION COUNTY SURVEYOR Date Received File No.

NOTE: See "Explanation for Successor Certifying Surveyor" statement in Narrative of Record of Survey, CS 010-2015, filed concurrently with this Land Corner Record.