CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. Z-21

History of original corner establishment:

Corner was originally established by J. C. Cooper, under G.L.O. contract No. 397, in July, 1881. Surveyors General's notes state: "Set post 4 1/4 ft. long 4 ins. square 2 ft. in ground for Standard on. to sec. 35 and 36 marked S.C. T5S R37E on N., S36 on E. and S35 on W. face with 1 notch on E. and 5 notches on W. faces. A white fir 8 ins.
diam. bears N52°W, 33 lks. dist. marked T5S R37E
S35 BT. A pine 6 ins. diam. bears N22°E, 21 lks. dist. marked
T5S R37E S36 BT."

DIAGRAM T5SR37E S35 **1** S36

Description of corner evidence found:

Found no trace of wood post. Found down white fir 18" in diam. with scribing, N53°W, 21.7 ft. A 32" white fir with full scribing bears S34°E, 21.1 ft. No trace of NE BT.

Description of monument and accessories I established to perpetuate the original location of this corner:

At center of above described point set 2 1/2" T5SR37E x 30" galvanized pipe and brass cap marked: S35 | S36 Set pipe 24" in the ground and placed mound of stone around. T6SR37E From which, by magnetic declination of N20°E: OR PLS 1051 A 5" pine bears N38°E, 34.3 ft. scribed T5SR37E 1979 S36 BT. An 8" fir bears N76°W, 34.8 ft. scribed T5SR37E S35 BT. Placed 54-3s and brass washers stamped PLS 1051 on BTs. No good large BTs in NE & NW quadrants. Location tag on large opened tamarac 30' NE. Painted blazes red and 6" red band around. Placed 54-2 on steel fence post 5' East and 54-2 and 54-4 on steel fence post 5' North of corner.

PROFESSIONAL LAND SURVEYOR

REGISTERED

OREGON
OCT. 17, 1975
BARRY B. BARBOUR
1 0 5 1

I hereby certify that the above corner monument was reestablished as herein described.

Witnesses:

David L. Landers Robert S. Stevens

August 1, 1979

Office of	County.	Surveyor	County of	Union	
State of	Oregon,,	hereby certify	that the wishin	instrument was filed	
for record on the	6than of I	Decembon	CHECKIE MICHIN	Instrument was filed	in this office

COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR

Form R6-7100-57 (9/71)

Date Received-0-798-276

Date Filed

Fi'e No. 681-84R

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner set by Jacob C. Cooper, under GLO Contract No. 397, approved April 5, 1882. Record States: Set post 4 $\frac{1}{2}$ ft long 4 ins square 2 ft in ground for Standard cor. to sec 35 and 36 marked S6 T5S R37E on N, S36 on E, and S35 on W face with 1 notch on E and 5 notches on W. face. From which:

A white fir 8 ins diam bears N52°W 33 lks dist marked T5S R37E S35 BT A pine 6 ins diam bears N22°E 21 lks dist marked T5S R37E S36 BT


Subsequent Monumentation

Corner was remonumented by Barry B. Barbour, LS 1051, as described by File No. 681-84R, filed December 6, 1979, in the records of the Union County Surveyor.

Record states: Found no trace of wood post. Found down white fir 18" in diam. with scribing, N53°W, 21.7 ft. A 32" white fir with full scribing bears S34°E, 21.1 ft. No trace of NE BT. At center of above described point set 2½" x 30" galvanized pipe and brass cap marked (as shown

At center of above described point set $2\frac{1}{2}$ " x 30" galvanized pipe and brass cap marked (as show below): Set pipe 24" in the ground and placed mound of stone around. From which by magnetic declination of N20°E:

A 5" pine bears N38°E, 34.3 ft. scribed T5SR37E S36 BT. An 8" fir bears N76°W, 34.8 ft. scribed T5SR37E S35 BT.

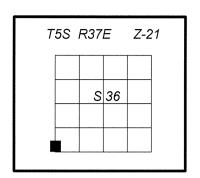

Description of corner evidence found:

Found $2\frac{1}{2}$ ins. diam. iron pipe, projecting 6 ins. above ground, with rock collar and $2\frac{1}{2}$ ins. diam. brass cap, marked as shown:

From the recovered monument I find the Barbour bearing trees:

A lodgepole pine, 7 ins. diam., bears N. 38° E., 34.3 ft. dist., alive and healthy, with scribing visible on a partially open double blaze.

A white fir, 13 ins. diam., bears N. 76° W., 34.8 ft. dist., alive and healthy, with healed double blaze. Tree of unknown origin, noted on Barbour's corner record:


A white fir, 35 ins. diam., bears S. 34° E., 21.1 ft. dist., alive and healthy, with T6S R37E 2 visible on open blaze with ax marks.

Trees of unknown origin:

A tamarack snag, 17 ins. diam., bears N. 48° E., 24.5 ft. dist., with ax marks on open blaze, no scribing visible, and Location Tag (54-5) and Attention (54-4) sign attached.

A white fir, 26 ins. diam., bears N. 65° W., 31.2 ft. dist., with open blaze and ax marks, no scribing visible.

Found guard post ±5 ft. N'ly, added Property Boundary (54-2) and Land Survey Monument (54-9) signs.

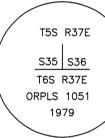

Description of monument and accessories I established to perpetuate original location of this corner:

New bearing tree:

A tamarack, 5 ins. diam., bears N. 22° W., 29.5 ft. dist., mkd. X BT on double blaze.

Set guard post ±5 ft E'ly with Property Boundary (54-2) sign.

All new bearing trees are marked on a single blaze unless noted otherwise and have a nail with a brass washer stamped "LS 2648" right side center for distance measurements.

Painted 6 ins. red bands and added Bearing Tree (54-3) and Land Survey Monument (54-9) signs as needed to all bearing trees.

Auto C/A geographic position: Lat. 45°04'44.5" N Long. 118°08'12.8" W

I hereby certify that the corner is monumented and accessories taken as described, using a Warren Knight staff compass, set with 15° East declination, and steel tape on August 23, 2014.

Witnesses: Brenda Johnson and Justin Seal

NOTE: See "Explanation for Successor Certifying Surveyor" statement in Narrative of Record of Survey, CS 010-2015, filed concurrently with this Land Corner Record.

REGISTERED PROFESSIONAL LAND SURVEYOR

Deceased

OREGON
JANUARY 18, 1994
RON C. WALTER
2648

Renewal Date: June 30, 2016

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON
July 22, 1977
WILLIAM R. WELLS

1106 Renewal Date: June 30, 2016

UNION COUNTY SURVEYOR					
Date Received 2 25 15					
Date Filed 7/25/15					
By Rif Glim					
File No. 019-7015 R					